SURVEY &	
CHEMONUMENTATION	

DEC 1 6 1996

For corners in

COMMISSION

JUDITH D. ROEHM Ontonason County 4/ 93 JEM

07/11/96 08:45

Fee: 9.00

Page 1

LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

ONTONAGON (County)	Located In:	Corner Code #
1. Public Land Survey	T <u>47N</u> R T <u>48N</u> R	40W 40W H-13
Property Controlling in Section Miscellaneous	TR S TR S TR	
Property in Sec.	S TR	


Register of Deeds Stamp & File Number

, Recorded Plat 5. Private Claims

1 Corner common to Sections 3 & 34, T47N &T48N, R40.

Farl W. Applekamp, in a field survey on May 22, 19 96 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

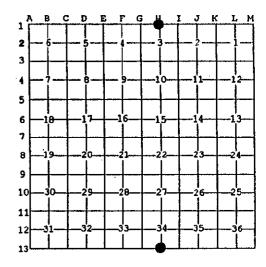

A. Description of original monument and accessories and/or subsequent restoration:

Original corner established by John Burt, U.S. Deputy Surveyor, July 13, 1850. Set Maple Post.

ORIGINAL BEARING TREES:

Cedar 14" N76°E

Cedar 18" N40°W 11 links

· 41 links

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

No original evidence was found. Corner was re-established by single proportionate measurement between opposite section corners East & West and using the existing old fence line to set the latitude.

PEER GROUP APPROVED polekano l W COUNTY SENTATIVE

Research on file with the Ontonagon County Remonumentation Representative.

07-08-96

APPLEKAMP PROFESSIONAL

SURVEYOR NO.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

at the corner position I set a $2\frac{1}{2}$ "X30" aluminum pipe with a $3\frac{1}{2}$ " cap: stamped to read: County Remonumentation, 4, T47N, T48N, R40W, 1996, P.S. 17610. I established three bearing trees and one reference object.

6" Oak 12" Oak

N70°W N13°E

54.88

4" Spruce S16°E

36.92'

Steel Sisn Post North 1.63'

17610 Surveyor's Michigan License No.

53.131

E AND POPESSIONE June 20. 1996 Date