JUDITH D. ROEHM

Ontonason County LO

5/ 109

Page 1 of 1 JEM Rec. Date 07/29/98 Time 13:16 9.00

LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

For corners in		
ONTONAGON	Located In:	Corner Code #
(County)		
1. Public Land Survey	T48NR	
	TR TR	
	TR	
2. Property Controlling in Section	S TR S T R	
3. Miscellaneous	ST_R	
Property in Sec.	S TR	

JAN 11 1999 SECTION


Register of Deeds Stamp & File Number

. Lot No	, Recorded Plat
. Private Claims	

1/4 Corner common to Sections 20 & 29, T48N R40W.

i, Earl W. Applekamp, in a field survey on June 17 , 19 98 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

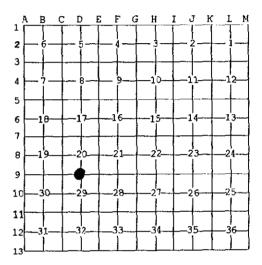

A. Description of original monument and accessories and/or subsequent restoration:

Original corner established by Wells Burt, U.S. Deputy Surveyor, June 6, 1851. Set Wood Post.

ORIGINAL BEARING TREES:

12" Maple

s76°W

12.54 feet

16" Hemlock

S39°E

12.54 feet

7-22-98

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

No original evidence was found. Corner position is in an East-West County road (Old M-28) which has been in existence since about 1915. The only evidence was an occupied fence representing the 1 line, owned by George Wolfe, 60 years old, who testified that the line was originally placed there by his grandfather about 1900. The full Section is 30 feet short and a split would place the corner in the yard of a house. I re-established the corner at the projection of the fence line described above as being the only logical position for the corner.

Research on file with the Ontonagon County Remonumentation Program Representative.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

At the corner position I set a 5/8"X12" rebar with a 3" stamped cap 3" below top of blacktop. Cap is stamped to read: County Remonumentation, T48N R40W, $\frac{1}{4}$, S20, S29, 1998, P.S. 17610. I established a Reference Monument, a $2\frac{1}{2}$ "X30" split base aluminum pipe with a 3" cap stamped to read as above. I also established 3 bearing trees.

AND OF MICHAELER EARL W. APPLEKAMP PROFESSIONAL TO TOPESSIONAL

s00°-31 '-18"W REF. MON. Nail in 20" W. Pine S13°W

31.26' - Nail in 15" Spruce N56°W 53.89' 57.77' - Nail in 16" W. Pine S45°E 96.88'

W. applekang

Date July 20, 1998