

APR 29 1996

COMMISSION

JUDITH D. ROEHM 12/18/95
Ontonagon County 14:55
LC 4/ 3 JEM Fee: 9.00
Page 1 of 1

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in Ontonagon Located In: _____ Corner Code # _____
(County)

- 1. Public Land Survey T 48N R42W A-11
T 48N R43W M-11
T _____ R _____
T _____ R _____
- 2. Property Controlling S _____ T _____ R _____
in Section S _____ T _____ R _____
- 3. Miscellaneous S _____ T _____ R _____
Property in Section S _____ T _____ R _____

Register of Deeds Stamp & File Number

- 4. Lot No. _____, Recorded Plat _____
- 5. Private Claims _____
Section corner common to Sections 25, 30, 31 & 36, T48N, R42-43W.

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		

I, John R. Garske, in a field survey on November 27, 1995, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Professional Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- Corner established by John Burt, U.S. Deputy Surveyor, in 1847. Original bearing trees:
24" hemlock - S54°E - 34 links 18" hemlock - N55°W - 24 links
- On October 14, 1969, Donald D. Lappala, USFS Surveyor, RLS 12585, restored the corner from remains of the two original bearing trees. At the corner position he set a 2 1/2" I.D. x 5' concrete filled galvanized iron pipe, capped with a 3" circular bronze tablet which reads: T48N, R42-43W; S-25; S-30; S-31; S-36; RLS 12585, 1969, from which he established the following bearing trees:
8" sugar - N50°W - 30.3 feet
6" sugar - S88°E - 14.2 feet
5" sugar - S78°W - 15.1 feet

Corner recorded in Ontonagon County, USFS Book.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

On November 27, 1995, I found the monument and bearing trees as set by Lappala in 1969, all in good condition. I repainted the bearing trees and got new measurements as noted below.

Act 74 record research on file with County Register of Deeds office.


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

I used the monument set by Lappala and updated the corner according to state and county specifications as follows:

- 10" sugar - N50°W - 30.30 feet (existing)
- 8" sugar - S88°E - 14.20 feet (existing)
- 8" sugar - S78°W - 15.10 feet (existing)
- Steel sign post - S25°E - 1.10 feet

PEER GROUP APPROVED

Paul W. [Signature]
COUNTY REPRESENTATIVE

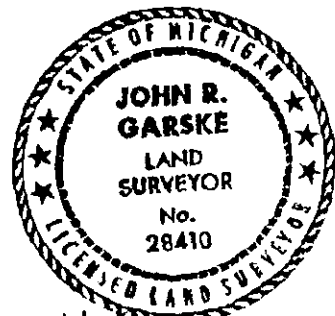

Signed by John R. Garske

Date 12-11-95

Surveyor's Michigan License No. 28410