DEC 1 6 1996

JUDITH D. ROEHM Ontonason County 03/04/96

Fee: 4/ 27 JEM

15:25 9.00

COMMISSION

LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970 Page 1

For corners in Ontonagon Located In: Corner Code ## T 49N.R 38 W. 1. Public Land Survey T R T 50N.R 38 W. **Property Controlling** Т R

\_\_ T \_\_\_\_ R \_

\_\_ T .\_\_\_ R \_\_

Register of Deeds Stamp & File Number

Recorded Plat

S

5. Private Claims\_

in Section


Miscellaneous

Property in Sec.

Section Corner 4, 5, 32, & 33; T.49-50 N., R.38 W.

July 18 Richard L. Drahn in a field survey on do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in tines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

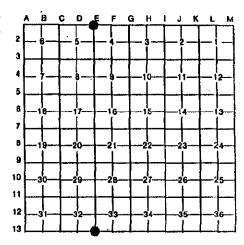

A. Description of original monument and accessories and/or subsequent restoration:

Original corner established by Austin Burt, Deputy Surveyor on June 24, 1847.

Original bearing trees:

N.57 E. (16.50 feet) Y. Birch 12" 25 links 12" N.13 W. 21 links (13.86 feet) Fir

Bearing trees by Artimas Curtip, Deputy Surveyor on June 12, 1851.

18 links (11.88 feet) 7" s.33 W. Hemlock S.77 E. (20.46 feet) 31 links Y. birch

Corner research on file with Ontonagon County records. (6/6/95)

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

No evidence of original corner or bearing trees found. Corner position re-established on line between and proportionate distance from the section corner 1 mile east and the quarter corner 1/2 mile west.

An F.S. Location Poster on a downed 10" Elm tree bears S.05 W., 6 feet from the re-established corner position.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

At the corner position I set a  $2\frac{1}{2}$ " X 30" long aluminum monument with a  $3\frac{1}{4}$ " aluminum cap, stamped to read: T.49-50 N., R.38 W.; S-4, S-5, S-32, S-33; 1995; R.L.S. 21564. From which I established the following new

blazed and scribed bearing trees: 6" N.14 E. 13.33 feet Sugar Maple s.65 E. 18.05 feet 8" Hemlock 6" s.40 W. 27.83 feet Sugar Maple 1.75 feet Steel rail s.02 W.

Date February 26, 1996

Surveyor's Michigan License No.

AND LAND SURVEYORS, JA PEVISEO M FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAM. 26, 187 REVISED JAH., 188

THE OF MICHAEL

RICHARD

L. DRAHN

LAND