SERVICE MENTATION

DEC 1 6 1998

JUDITH D. ROEHM Ontonason County 07/11/96 09:08

Fee:

4/ 124 JEN

## 9.00 Page 1 of 1

## COMMISSION LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

For corners in Located In: Corner Code ## Ontonagon T 49N R 43W 1. Public Land Survey \_ R T 48N R 43W 2. Property Controlling R\_

T \_\_

Τ.

Т

Register of Deeds Stamp & File Number

\_\_ , Recorded Plat 5. Private Claims

S


in Section Miscellaneous

Property in Sec.

Sec. Cor. 3, 4, 33 & 34; T.48-49 N., R.43 W.

Richard L. Drahn in a field survey on June 17, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

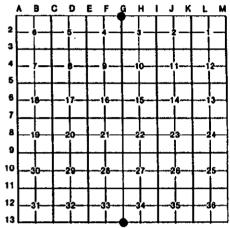

A. Description of original monument and accessories and/or subsequent restoration: Corner established by John Burt on Aug. 16, 1847. Original B.T.s: --Maple 18" N.82 E. 47 links (31.02') --- Y. Birch 24" N.05 W.39 links (25.74'). Corner restored by Donald D. Lappala, RLS 12585 on 9/3/68 from the scribed remains of the Y. Birch bearing tree. He set a 2" dia. iron pipe with a 3" stamped brass cap and the following new B.T.s: --- 11" (14") Yellow Birch N.81 W. (N.81 W.) 20.6' (20.66') --- 5" (10") Sugar Maple N.84 E. (N.86 E.) 64.3' (64.32') --- 6" (10") Yellow Birch S.27 E. (S.25 E.) 45.2' (45.27') --- Corner recorded in Ontonagon County in USFS Liber, Page A-13 (T.48 N.) on 4/1/69.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner: Act 74 research form on file with Ontonagon County records.

Recovered the monument as described and the bearing trees as noted in parentheses above.

A large, badly decayed Yellow Birch stump is all that remains of the original bearing trees.

> COUNTY 07-08-96

C. Description of monument for corner and accessories established to perpetuate locating the position of the comer:

Bearing objects referenced:

4" X 4" Cedar sign post S.37 E. 2.35

6' Steel sign rail S.60 W. 3.6'

RICHARD L DRAHN LAHD SURVEYOR 21564

\_ Date \_ June 20, 1996

Surveyor's Michigan License No. 21564

HSFS Z-13 (T.49 N)

A-13 (T.48 N)

REVISED MAY 14, 1978 REVISED JAN., 1983

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAH. 28, 1971