

**LAND CORNER RECORDATION CERTIFICATE**  
 Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Ontonagon  
 (County)

Located In: \_\_\_\_\_ Corner Code # \_\_\_\_\_

1. Public Land Survey T 50N R 38W D-1  
 T \_\_\_\_\_ R \_\_\_\_\_  
 T \_\_\_\_\_ R \_\_\_\_\_  
 T \_\_\_\_\_ R \_\_\_\_\_

2. Property Controlling in Section S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_  
 S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_

3. Miscellaneous Property in Sec. S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_  
 S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_

5. Private Claims \_\_\_\_\_

**SURVEY & REMONUMENTATION**

APR 07 1998

SECTION

Register of Deeds Stamp & File Number

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6		5		4		3		2		1	
3												
4	7		8		9		10		11		12	
5												
6	18		17		16		15		14		13	
7												
8	19		20		21		22		23		24	
9												
10	30		29		28		27		26		25	
11												
12	31		32		33		34		35		36	
13												

I, Joseph C. Domitrovich, in a field survey on November 6, 1997 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below.

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

**(D-1) North 1/4 Corner Section 5, T 50N, R 38W**

A. Description of original monument and accessories and/or subsequent restoration:  
 This corner was not set in the original survey. Closing Corners to the East and West were set by Sylvester W. Higgins in July 1847.  
 Corners on the South side of T 51N, R 38W, defining the correction line, were set by Austin Burt in August 1845.  
 1899 - Chas. S. Butts, Surveyor, for the Plat of Mass City, shows this corner as being on the North line of Lot 2, Block 71. It is indicated as being a 1 1/2" iron rod, but no bearings or distances are given to it.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:  
 I found no remains of the corner mentioned in the Plat of Mass City. The corner now falls in the backyard of House #1607, Ridge Avenue. I re-established the corner position midway between Closing Corners to the East and West and on the correction line between the South 1/4 Corner and the SE Corners of Section 35, T 51N, R 38W.  
 The corner falls 5.8 feet North of the North wall of a brick style tarpaper sided shed, in Lot 2, Block 71.


PEER GROUP APPROVED

Carl W. Applekamp  
 COUNTY REPRESENTATIVE 11-11-97

Research on file with County Remonumentation Representative.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:  
 Corner is a 2" x 30" aluminum pipe with a 3" diameter aluminum cap stamped to read: COUNTY REMONUMENTATION, T. 50N, R. 38W; C.C.; 1/4; S. 5; 1997; P.S. 37273.

Witnesses:  
 12" Spruce S 77° E 48.18'  
 NW Cor. Tarpaper-sided Shed S 76° W 22.38' (no nail set)  
 SE Cor. Gray-sided Shed N 72° W 35.62' (no nail set)  
 E'ly tree of clump of 5-3" Cherry trees N 02° E 59.91'

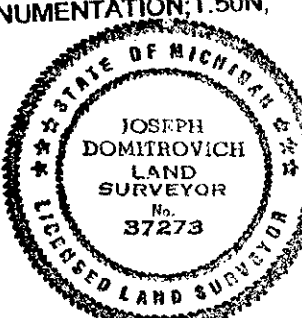

NOTE: Bearings are magnetic. Distances are to nail in side of witness objects unless noted.

Signed by Joseph C. Domitrovich  
 Surveyor's Michigan License No. 37273

Date 11/10/97