

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

<u>Ontonagon</u> (County)	Located In:	Corner Code #:
1. Public Land Survey	T <u>50N</u> R <u>42W</u>	<u>G-11</u>
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
4. Lot No. _____, Recorded Plat _____		
5. Private Claims _____		

REMOVED
 OCT 3 9 1997
 COMMISSION
 Register of Deeds Stamp & File Number

Section Corner 27,28,33 & 34: T.50 N., R.42 W.

I, Richard L. Drahn in a field survey on May 18, 19 97, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

Corner established by Austin Burt on June 18. 1848. Original B.T.s --- Hemlock 20" S.31½ E. 12 links (7.92 feet) --- Sugar 12" N.45 E. 36 links (23.76 feet). ---

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Search area positioned by compass and chain from monumented corners one mile south and west. Corner position found marked by a 1" X 36" iron pipe. The location of the iron pipe checks well to stream locations north, south, east and west and west to a very large windthrown stump hole (species undetermined), given in the original field notes as a "Hemlock 30"". No evidence remains of the original bearing trees. After discussions with the Peer Review Group on 5/12/97 it was decided that the iron pipe best represented the point set in 1848.


Research form on file with Ontonagon County records.

PEER GROUP APPROVED
Carl W. Applekamp
 COUNTY REPRESENTATIVE 6-10-97

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Over the top of the iron pipe I set a 2½" X 30" aluminum pipe with a 3¼" aluminum cap stamped to indicate the corner: from which I established the following new bearing trees:

- 8" Red Maple N.14 E. 6.08 feet
- 7" Sugar Maple N.78 E. 18.27 feet
- 12" N. Red Oak S.10 E. 23.97 feet
- 6' Steel sign rail N.84 W. 1.68 feet

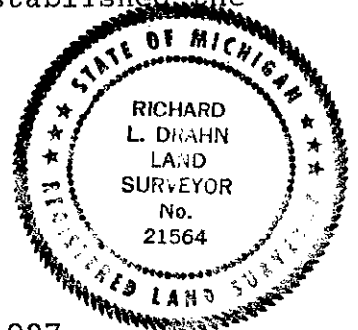

Signed by Richard L. Drahn Date June 5, 1997
 Surveyor's Michigan License No. 21564