

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>51</u> N. <u>W.</u> , R. <u>37</u> <u>W.</u>	<u>K-9, K-7, L-7</u>
2. PROPERTY CONTROLLING IN SECTION _____	, T. _____ N. _____ E. _____ S., R. _____ W. _____	_____
3. MISCELLANEOUS PROPERTY IN SECTION _____	, T. _____ N. _____ E. _____ S., R. _____ W. _____	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER _____

I, Keith L. Sackett, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on See below, 19____, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

- Corner K-9: Original monument and accessories not found. Found 1-3/4" I.D. iron pipe 3' above ground and two old cedar posts.
- Corner K-7: Original monument and accessories not found. Found 1" I.D. on pipe 2' above ground.
- Corner L-7: Original monument and accessories not found.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- Corner K-9: Re-established 6/29/76 at iron pipe.
- Corner K-7: Re-established 7/1/76 at iron pipe.
- Corner L-7: Re-established 7/1/76 on line between section corners east and west.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- | | |
|--|--|
| <p><u>Corner K-9:</u> 1-3/4" I.D. iron pipe 3' above ground.</p> <p>9" Sugar N81°E 19.7' S24, NBT
 14" Sugar N04°W 24.9' S23, NBT
 8" Y. Birch S51°E 20.8' S25, NBT</p> <p><u>Corner K-7:</u> 1" I.D. iron pipe 2' above ground.</p> <p>3" Hemlock S18°E 3.6' S24, NBT
 12" Y. Birch S75°W 3.7' S23, NBT
 14" Sugar N57°E 26.5' S13, NBT</p> | <p><u>Corner L-7:</u> Set 1" I.D. x 36" iron pipe with 4" aluminum cap.</p> <p>7" Maple N51°W 13.7' 1/4S, NBT
 8" Sugar S70°W 17.1' 1/4S, NBT
 12" Sugar S65°E 21.5' 1/4S, NBT
 Square 4" Sugar North 2.1' marked 1/4, 13, 24.</p> |
|--|--|

SIGNED BY _____ DATE _____


SURVEYOR'S MICHIGAN REGISTRATION NO. _____ (SEAL)

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

APPROVED AND SIGNED BY Keith L. Sackett DATE 8/4/76
CHIEF OF SURVEY PARTY
 MICHIGAN REGISTERED LAND SURVEYOR
 Keith L. Sackett

SURVEYOR'S MICHIGAN REGISTRATION NO. 19006

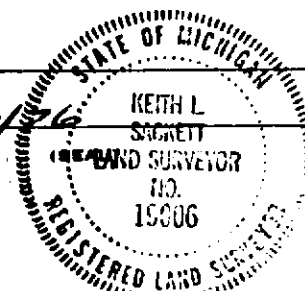

FORM APPROVED BY MICHIGAN STATE BOARD OF REGISTRATION, NOV. 28, 1971
 REVISED MAY 14, 1975

MAY PLACE SKETCH ON BACK OR ATTACHED SHEET