

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>51N</u> N. S., R. <u>37</u> E. W.	<u>C9, B9</u>
2. PROPERTY CONTROLLING IN SECTION _____	<u>30</u> T. <u>51</u> N. S., R. <u>37</u> E. W.	<u>2</u>
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ N. S., R. _____ E. W.	

4. LOT NO. _____, RECORDED PLAT _____

5. PRIVATE CLAIMS _____

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Keith L. Sackett, do hereby certify that under requirements of P.A. 74, Michigan P.A. _____ the corner points mentioned in lines 1 and 2 above were, in a field survey on See below, 19____, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules thereon as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 1 and 2 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or by a decree of a Court of law:

Description of original monument and accessories and/or subsequent restoration:

Corner C9: Original monument and accessories not found. Found 1" I.D. iron pipe _____ witnessed by W. A. Waara May 12, 1940.

Corner B9: Original monument and accessories not found.

Corner 2: Not set on original survey nor subsequently apparently.

Description of corner evidence found and/or method applied in restoring or re-establishing corner:

Corner C9: Re-established 5-27-76 at iron pipe location. This pipe was set from original bearing trees which were still visible May 12, 1940.

Corner B9: Re-established 6-21-76 on line between section corners east and west.

Corner 2: Established 6-22-76 on line between 1/4 corner west and section corner east.

Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Corner C9: Set 1" I.D. x 24" iron pipe with 4" alum. cap. Buried 6" deep in east rut of original bearing trees.
 11" Y. Birch S 2° E 40.3 ft. S29, NEP
 10" Hemlock S51° W 43.6 ft. S30, NEP
 11" Sugar N46° E 13.0 ft. (This is original reference tree.)

Corner B9: Set 1" I.D. x 36" iron pipe with 4" alum. cap.
 11" Y. Birch N41° W 5.7 ft. S29, NEP
 10" Hemlock S33° E 13.0 ft. S29, NEP
 11" Sugar N72° E 22.8 ft. S29, NEP

Corner 2: Set 1" I.D. x 36" iron pipe with 4" alum. cap.
 6" Sugar N35° W 20.3 ft. 1/100, S
 12" Hemlock N63° E 16.9 ft. 1/100, S
 14" Y. Birch S23° W 14.0 ft. 1/100, S

SIGNED BY _____ DATE _____


SURVEYOR'S MICHIGAN REGISTRATION NO. _____

(SEAL)

FOR STATE AND UNITED STATES AGENCIES

SIGNED BY _____ DATE _____

APPROVED AND SIGNED BY Keith L. Sackett DATE _____
 CHIEF OF SURVEY PARTY
 MICHIGAN REGISTERED LAND SURVEYOR
 NO. 19006

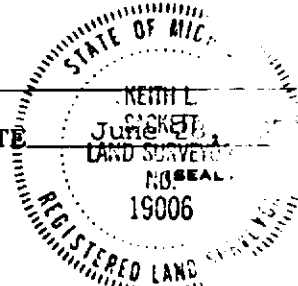

3. SURVEYOR'S MICHIGAN REGISTRATION NO. 19006

FORM APPROVED BY MICHIGAN STATE BOARD OF REGISTRATION JAN 1970

MAY PLACE SKETCH OR ATTACHED SHEET