

JUDITH D. ROEMM

1F

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970  
Ontonagon County Remonumentation Corner

Ontonagon County

of 1

LC

5-213

Rec. Date 07-27-99 Time 15:01

RECORDING FEE:

9.00

For corners in

Ontonagon County	Located in:	Corner Code #
1. Public Land Survey	T51N R39W	F-7
	T R	
	T R	
	T R	
2. Property Controlling in Section	S T R	
	S T R	
3. Miscellaneous Property in Sec.	S T R	
	S T R	
4. Lot No. , Recorded Plat		
5. Private Claims		

SURVEY &  
REMONUMENTATION

MAR 23 2000

SECTION

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, Joseph C. Domitrovich, in a field survey on July 16, 1999, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

(F-7) 1/4 Corner Common to Sections 16 and 21, T51N, R39W.

- 1845 - Austin Burt set a Sugar Post
- 14" Hemlock S22°W 24 links
- 12" Sugar N36°E 18 links

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


I found no remains of the original corner or accessories. An east - west two-track trail now runs approximately along the Section line. I reestablished the corner position by single proportionate measurement. Distances to Section corners East and West work well with GLO.

Research on file with County Remonumentation Representative.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Corner is a 5/8" iron pin with a 3" diameter aluminum cap stamped to read: COUNTY REMONUMENTATION; T.51N., R.39W.; 1/4; S.16, S.21; 1999; P.S. 37273. Corner falls in the middle of an old east - west two-track trail. Ties:

6" Poplar	N01°E	19.50'
Steel Sign Rail	S02°W	16.43' (to face)
4" Soft Maple (in clump)	S72°W	49.10'
6" Oak	N29°W	26.56'
NE Corner Sec. 21	N89°40'35"E	2634.91' (2633.40' GLO)
NW Corner Sec. 21	S89°40'35"W	2634.91' (2633.40' GLO)

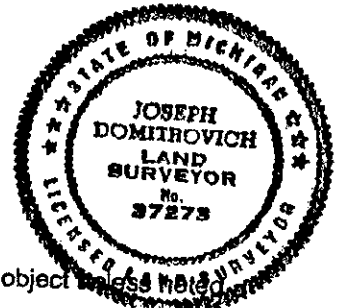

NOTE: Bearings to witness objects are magnetic. Distances are to a nail in side of the witness object unless noted.

FIELD BOOK APPROVED

Carl W. Applkamp 7-20-99  
COUNTY REMONUMENTATION

Signed by J. C. Domitrovich

Date 7/20/99

Surveyor's Michigan License No. 37273