

SURVEY & REMONUMENTATION

DEC 16 1996

JUDITH D. ROEHM
 Ontonagon County
 LC 4/38 JEM Fee: 9.00
 04/02/96
 14131
 Page 1 of 1

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in **COMMISSION**
Ontonagon
 (County)

Located In:

Corner Code #

- | | | | | | |
|--------------------------------------|---|------------|---|------------|------------|
| 1. Public Land Survey | T | <u>51N</u> | R | <u>40W</u> | <u>C-9</u> |
| | T | _____ | R | _____ | _____ |
| | T | _____ | R | _____ | _____ |
| | T | _____ | R | _____ | _____ |
| 2. Property Controlling in Section | S | _____ | T | _____ | _____ |
| | S | _____ | T | _____ | _____ |
| 3. Miscellaneous Property in Section | S | _____ | T | _____ | _____ |
| | S | _____ | T | _____ | _____ |
4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L
2	6			5				4		3		2
3												
4	7			8				9		10		11
5												
6	18			17				16		15		14
7												
8	19			20				21		22		23
9												
10	30			29				28		27		26
11												
12	31			32				33		34		35
13												

I, Joseph C. Domitrovich, in a field survey on September 29, 19 95, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Professional Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

C-9 Corner common to Sections 19, 20, 29 and 30

1845 - William A. Burt set Sugar post
 9" Hemlock S18°E 16 links
 14" B. Oak N64°W 17 links

1967 - L.P. Walsh Highway construction plans show a found 1" pipe and a monument box to be placed at this corner. Also a distance (by stationing) was shown to the 1/4 corner to the north.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Original Corner, Bearing trees and subsequent perpetuation have been removed by Highway construction. No evidence of the Monument Box remains.

Found a R.O.W. monument and two offset hubs to the east. I re-established the corner position using the offset hubs and centerline of Highway. Using this position, the distance north to the 1/4 corner matched closely that noted on the construction plans.

This position also works well with corners to the west. Accepted this position as the section corner and monumented it as such.

Research on file with County Remonumentation Representative.


PEER GROUP APPROVED
Paul W. Appelkamp
 COUNTY REPRESENTATIVE

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Corner is a 3/4" aluminum Rod with a 3" stamped Aluminum cap, set 1" below pavement in centerline L.P. Walsh Highway, and protected by asphalt cold patch. Corner falls 4 feet south of centerline Quartz Road to west.

Witnesses

Concrete R.O.W. Monument	East	75.00'
Stamped Aluminum Reference Monument	S 60° W	64.66'
Steel Sign Post	S 60° W	65.00'
1/2" iron w/cap No. 37273	West	75.00'
1/2" iron w/cap No. 37273	N 66° W	81.85'

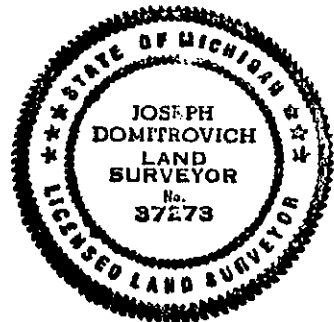

NOTE: Bearings are magnetic. Distances are to nail in side of witness objects unless noted.

Signed by J. C. Domitrovich

Date 3/26/96

Surveyor's Michigan License No. 37273