APR 2 9 1996

## COMMISSION

JUDITH D. ROEHM Ontonagon County 10

12/18/95

14:58

5 JEM Feet Pase

## LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

For corners in ONTONAGON (County)	Located In:	Corner Code #
Public Land Survey	T <u>52</u> R <u>40</u> T <u>52</u> R <u>39</u> T <u>51</u> R <u>40</u> T 51 B 39	M-13 A=13 M-1 A-1
L. Topoli, commis	ST R ST R	
o. m.comanosao	S T R S T R	

Register of Deeds Stamp & File Number


\_\_\_ , Recorded Plat\_

Private Claims

Section Corner common to \$1, 6, 31 & 36, T51 & 52N, R39 & 40W.

L Earl W. Applekamp, in a field survey or August 19 do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Professional Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

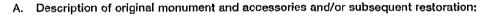

Original corner established by William A. Burt, U.S. Deputy Surveyor, August 1845. Set Post.

ORIGINAL BEARING TREES:

N17°E 42 links (27.72 feet) - 24" Hemlock N30°E 31 links (20.46 feet) Hemlock 18" S79°W 27 links (17.82 feet) - 16" Birch N18°W 20 links (13.20 feet)

## B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

No original evidence found. At the corner position I found a  $1\frac{1}{2}$  pipe, pipe is identified in MDOT road plans for US-45. Pipe is also identified in the assessor's plat of Donnelly's subdivision No. 2, in the  $SW_4^1$  of Section 31, T52N R39W. Corner was used for Jones Subdivision of  $NW_{4}^{\frac{1}{4}}$  of Section 6, T51N R39W. Owner of the property at this corner, Jerry Koski, a Survey Technician, testified this corner has been there for many years and used for several surveys in the area. I accepted this position and monumented the corner as described below in "C".

Research on file.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

At the corner position I set a  $2\frac{1}{2}$ "x30" aluminum pipe with a  $3\frac{1}{4}$ " cap stamped to read: COUNTY REMONUMENTATION, T51 & 52N, R39 & 40W, S.1, S.6, S.31, S.36, 1995, P.S. 17610. I established the following bearing trees and reference objects:

10" Aspen 7" Aspen N60°W N25°E

12.85 feet - 12" Ash S74°E 17.81 feet

5" Maple

Surveyor's Michigan License No.

- Steel Sign Post, North 1.34 feet 9.59 feet

S05°W 7.68 feet



\_\_Date\_\_<u>October\_06, 1995</u>\_

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971

PROFESSIONAL SURVEYOR OF SURVEYOR NO. 17610