

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

OCT 30 1997

COMMISSION

For corners in

Ontonagon
(County)

Located In:

Corner Code #

1. Public Land Survey

T 51N R 40W A-12 Same
T 51N R 41W V M-12 Corner
T R
T R

2. Property Controlling
in Section

S T R
S T R

3. Miscellaneous
Property in Sec.

S T R
S T R

JUDITH D. ROEHM 06-13/97
Ontonagon County 15:32
LC 4/208 JJT Fee: 9.00
Page 1 of 1

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, Joseph C. Domitrovich, in a field survey on June 5, 1997 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

(A-12/M-12) 1/4 Corner Common to Sections 31 and 36, T 51N, R40/41W

A. Description of original monument and accessories and/or subsequent restoration:

1845 - Austin Burt, D.S., set post
18" Sugar S 49° E 10 links
7" Fir N 41° W 32 links

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I found no remains of original corner or accessories. I re-established the corner in the centerline of Townline Road (for East-West position) and midway between the Section corners North and South (for North-South position).

Research on file with County Remonumentation Representative.


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner.

Corner is a 5/8" Iron pin with a 3" diameter aluminum cap stamped: COUNTY REMONUMENTATION; T. 51N, R. 40W, R. 41W; 1/4; S. 31, S. 36; 1997; P.S. 37273. I also placed a Reference Monument (R.M.) to the West, a 2" x 30" aluminum pipe with a 3" diameter aluminum cap stamped to indicate that the 1/4 corner is East 38.80'.

Witnesses:

Power Pole	N 34° W	41.48'
8" Poplar	N 87° E	39.87'
10" Ash	S 49° W	71.74'
Reference Monument	S 88° 31' 23" W	38.80'
NW Corner Sec. 31	N 00° 08' 27" W	2634.90'
SW Corner Sec. 31	S 00° 30' 50" E	2634.90'

PEER GROUP APPROVED
Earl W. [Signature]
COUNTY REPRESENTATIVE 6-10-97

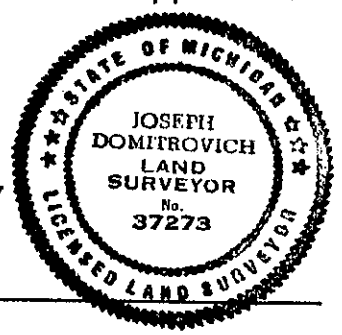

NOTE: Bearings are magnetic. Distances are to nail in side of witness objects unless noted.

Signed by Joseph C. Domitrovich Date 6/9/97

Surveyor's Michigan License No. 37273