

# SURVEY & REMONUMENTATION

APR 25 1995

## COMMISSION

For corners in

Ontonagon  
(County)

### LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

Located In:

Corner Code #

1. Public Land Survey

T 51N R 42W  
T \_\_\_\_\_ R \_\_\_\_\_  
T 51N R 43W  
T \_\_\_\_\_ R \_\_\_\_\_

M-4 ✓  
A-4

2. Property Controlling in Section

S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_  
S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_

3. Miscellaneous Property in Sec.

S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_  
S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_

Recorded December 7 1994  
at 4:15 o'clock P. M. in  
Liber 3 page 241  
*Julia M. [Signature]*  
Register of Deeds

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
5. Private Claims \_\_\_\_\_

One-quarter corner common to Section 12, T51N, R42W and Section 7, T51N, R41W

I, John R. Garske, in a field survey on October 27, 1994, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.**

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

A. Description of original monument and accessories and/or subsequent restoration:

Survey by Austin Burt in 1845. Set post from which a 20" hemlock bears S35W, 26 links and a 16" hemlock N15°E, 27 links.  
1953 MDOT Highway M-64 R/W Map - iron pin  
1970's E. Applekamp found corner.  
12/11/81 - Wm. Immich, RLS, recorded corner in L. 2, Pg. 7 in Ontonagon County Register of Deeds office.

**ONTONAGON COUNTY**

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

**PEER APPROVED**

Found 3/4" hex drill steel as noted above. The corner has been used in various surveys and is generally accepted as the one-quarter corner by area residents.

*E. Applekamp  
Ont. Co. Rep. 11-30-94*

I am accepting this corner position as the most probable location of the true one-quarter corner.

Act 74 record research on file.


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

I updated the corner position to state and county specifications by setting a 3 1/4" diameter cap atop the 3/4" hex drill steel and stamped: County Remonumentation; 1/4; S-12; S-7; T51N, R42W, R41W; 1994; RLS 28410. Established the following bearing trees and reference object: 8" R. maple - N65°E, 13.58 feet; 8" Y. birch - S18°W, 29.12 feet; 12" cedar - S70°W, 22.23 feet; 6" Y. birch - N29°W, 21.55 feet; 6 foot steel rail with sign - S14°E, 2.40 feet

Signed by John R. Garske

Date 11/28/94

Surveyor's Michigan License No. 28410

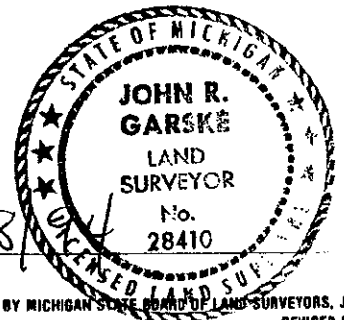

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 20, 1971  
REVISED MAY 14, 1975  
REVISED JAN., 1993