

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
Ontonagon
 (County)

Located In: Corner Code #

- | | | |
|------------------------------------|-------------|-----|
| 1. Public Land Survey | T 52N R 37W | M10 |
| | T 52N R 37W | K8 |
| | T R | |
| | T R | |
| 2. Property Controlling in Section | S T R | |
| | S T R | |
| 3. Miscellaneous Property in Sec. | S T R | |
| | S T R | |

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

K8 May 31 2001
 M10 May 30 2001

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:


NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

1	A	B	C	D	E	F	G	H	I	J	K	L	M
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

A. Description of original monument and accessories and/or subsequent restoration:
 (M10) Quarter corner common to Section 25 T52N-R37W and Section 30 T52N-R36W. 1845: Established by Wm.A.Burt. Set qr. Sect. post. Fir 14 S31W 28, Fir 10 N7W 14. 1945: William Waara reports - Found I.P. on side hill sloping E. to Sleepy Riv. in stand of hwd. & hea. timber. Found old names on 12" Ced. N22W 12 ft. Found old names on 14" Bal. stub 10' high N43E 8 ft. Put names on 7" Bal. N85W 4 ft. 1964: Billy D. Buckler found 1-1/4" iron pipe "re-witnessed as found by Copper Range Company. No original evidence". 11" Hard Maple S52E 42 links, 15" Cedar N17E 44 links.
 (K8) Quarter corner common to Sections 23 & 24. 1846: Established by S.W. Higgins. ...40.00 Set 1/4 Sect. post. Sugar 10 S65E 21, Sugar 12 N50W 40.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
 (M10) Found and accepted a 1-1/4" ID iron pipe at record bearing and distance from the 1964 NBTs and from the 1945 Cedar signature tree NW. Made new witnesses as described below.
 (K8) The original post and accessories were not recovered. Reestablished the corner on a line of mean true bearing (N 0 deg. 08 min. E) between Section corners 2879.71' north and south, being proportionate to the original record.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
 (M10) Found 1-1/4" ID iron pipe. Blazed and scribed:
 24" Cedar N69W 26.3' "1/4S NBT"
 14" Cedar N15W 11.0' do
 (This cedar is the 1945 signature tree)
 The 1964 NBTs:
 16" Cedar N21E 29.6' scribing visible
 11" Sugar S49E 27.5' do
 Bearings are magnetic. Distances to notch in lower blaze.
 (K8) Set 1" ID x 32" iron pipe with 4 alum. MDNR tablet. Blazed and scribed:
 8" Sugar N70E 41.0' "1/4S NBT"
 12" Sugar S42W 9.4' do
 8" Y. Birch N45W 23.3' do
 16" Sugar N27E 30.4' do
 Squared sugar post adjacent. Bearings are magnetic. Distances to notch in lower blaze.

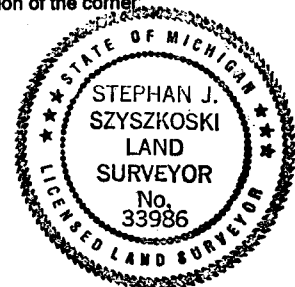

Signed by Stephan J. Szyszkoski Date 9/25/01
 Surveyor's Michigan License No. 33986

For the Michigan Department of Natural Resources - Office of Property Management