

SURVEY & REMONUMENTATION

APR 29 1996

COMMISSION

JUDITH D. ROEHM 10/19/95
 Ontonagon County 15:16
 LC 3/358 JEM Fees 9.00
 Page 1 of 1

LAND CORNER RECORDATION CERTIFICATE
 Filing Requirement of Act 74, Mich. P.A. 1970

For corners in Ontonagon Located In: _____ Corner Code # _____
 (County)

1. Public Land Survey	T	<u>52N</u>	R	<u>39W</u>	<u>E-12</u>
	T	_____	R	_____	_____
	T	_____	R	_____	_____
	T	_____	R	_____	_____
2. Property Controlling in Section	S	_____	T	_____	R
	S	_____	T	_____	R
3. Miscellaneous Property in Section	S	_____	T	_____	R
	S	_____	T	_____	R

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

Register of Deeds Stamp & File Number

A	B	C	D	E	F	G	H	I	J	K	L
2	6		5		4		3		2		1
3											
4	7		8		9		10		11		12
5											
6	18		17		16		15		14		13
7											
8	19		20		21		22		23		24
9											
10	30		29		28		27		26		25
11											
12	31		32		33		34		35		36
13											

I, Joseph C. Domitrovich, in a field survey on October 17, 19 95, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Professional Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

1/4 Corner Sections 32 and 33, T52N, R39W

1845 -William A. Burt set Y. Birch 1/4 post

12" Y. Birch N 21° E 20 links
 18" Lynn N 44° W 34 links

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found no remains of original corner. The area has been farmed for over 100 years. The best remaining evidence of the corner position is an old east-west fenceline. I re-established the corner holding the east-west fenceline for north-south position, and on line between section corners for the east-west position. Corner works well with centerline of north-south road.

(Research on file with County Remonumentation Representative.)


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Corner is a 5/8" x 24" rerod with a 3" diameter stamped aluminum cap and falls on the extension of old fencelines to east and west and falls on centerline of north-south Strang Road.

Witnesses:

5" Maple S 34° W 53.05'
 Reference Monument (Aluminum pipe with stamped aluminum cap) West 31.62'
 Sign Post West 32.48'
 Northerly Metal Gate Post N 66° W 61.80'
 10" Apple Tree N 32° W 59.33'

PEER GROUP APPROVED
Carl W. Applekamp
 COUNTY REPRESENTATIVE 10-18-95

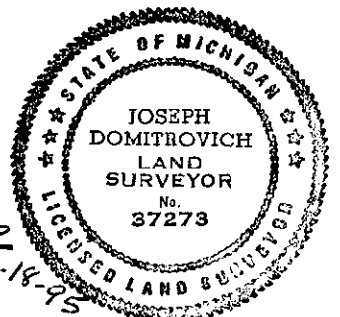

NOTE: Bearings are magnetic. Distances are to nail in side of witness objects unless noted.

Signed by J. C. Domitrovich

Date 10/18/95

Surveyor's Michigan License No. 37273