

REF: 8111-1-A

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

DEC 29 1999

For corners in

<u>Presque Isle</u> (County)	Located In:	Corner Code #
1. Public Land Survey	T34 R4E	B-3 ✓
	T R	
	T R	
	T R	
2. Property Controlling in Section	S T R	
	S T R	
3. Miscellaneous Property in Sec.	S T R	
	S T R	

SECTION

PRESQUE ISLE COUNTY  
RECORDED

1999 DEC -2 PM 2:13

*Delmer E. Porter*  
Register of Deeds Stamp & File Number  
REGISTER OF DEEDS

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
5. Private Claims \_\_\_\_\_

I, Delmer E. Porter in a field survey on Nov. 11, 1999 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.


	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

A. Description of original monument and accessories and/or subsequent restoration:

- |                              |                              |
|------------------------------|------------------------------|
| B-3 GLO Notes - 1840         | C. Kiiskila #33981           |
| Set Quarter Section Post     | L 322, Pg 424 & L 1, Pg 1009 |
| 10" Spruce Pine N40°W 23 Lks | Fd 1/2" Rod & Placed 1" Pipe |
| 12" Spruce Pine S70°E 4 Lks  | Over Found Rod               |
|                              | 8" Oak S06°W 30.35'          |
|                              | 14" R. Pine S79°W 60.12'     |
|                              | 18" R. Pine N10°W 45.26'     |
|                              | 8" Oak N52°E 30.61'          |

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

- B-3 Found 1" Pipe/DNR Cap (In Place)  
 N46°E 30.57' 10" Oak  
 S73°W 60.05' 13" Norway  
 S05°E 30.34' 7" Oak

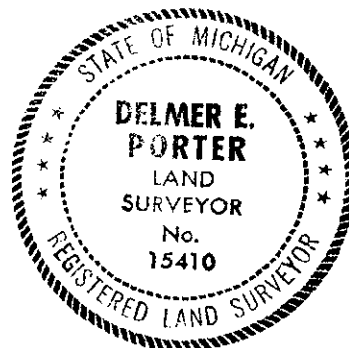

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- B-3 1" Pipe/Cap DNR  
 S50°W 61.90' 10" Norway  
 S73°W 60.06' 13" Norway  
 N30°W 45.26' 14" Norway  
 N46°E 30.57' 10" Oak  
 S05°E 30.34' 7" Oak

Ratified by Peer Group  
in accordance with P.A. 345

Chairman *Norm J. Quinn*  
Date 11/30/99

\*Witness tags & nails used.

Signed by *Delmer E. Porter*  
Surveyor's Michigan License No. #15410

Date 11-15-99