

1993

COMMISSION

PRESQUE ISLE COUNTY  
RECORDED

93 DEC 22 AM 10:04

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

PRESQUE ISLE  
(County)

Located In:

Corner Code #

- 1. Public Land Survey      T 34N<sup>R</sup> 2E      J-11  
    T    R  
    T    R  
    T    R
- 2. Property Controlling    S    T    R  
    in Section                S    T    R
- 3. Miscellaneous            S    T    R  
    Property in Sec.         S    T    R

*Jane M. Slamb*  
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

- 4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_
- 5. Private Claims \_\_\_\_\_

I, DELMER E. PORTER a field survey on DEC. 9, 19 93, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.**

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

A. Description of original monument and accessories and/or subsequent restoration:

J-11  
GLO NOTES  
JULY 11, 1855  
HEMLOCK 14" N 20° E 10 lks.  
HEMLOCK 16" S 67° W 11 lks.

J-11 P.A. 74 FILED BY C. (EUGENE OSTLI)  
L.S. 12026 SEPT 12, 1973 PAGE 22  
LAND CORNER RECORDS  
SET 1/2" BAR  
FENCE POST N 37° W 5.2'  
FENCE CORNER S 43° 40' W 5.0'  
FENCE POST S 40° E 5.7'


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

J-11  
DEC. 9, 1993  
FOUND 1/2" ROD & CAP #12026  
FENCE POST N 37° W 5.2'  
FENCE CORNER S 43° 40' W 5.0'  
FENCE POST S 40° E 5.7'  
ALL WITNESSES IN POOR CONDITION

Ratified by Peer Group  
in accordance with P.A. 345  
Chairman *Delmer E. Porter*  
Date December 18, 1993

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

J-11  
1/2" ROD & CAP #12026  
S 37° W 20.66' 3" BALSAM  
S 86° E 13.32' 9" MAPLE  
S 02° E 18.45' 3" BALSAM  
N 14° E 20.35' 4" MAPLE  
\* NAILS AND TAGS #15410 USED ON WITNESSES  
PORTER'S SURVEY, P.C.

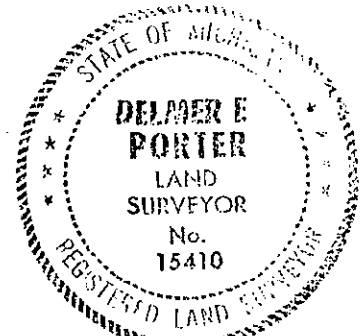

Signed by *Delmer E. Porter*

Date Dec 20, 1993

Surveyor's Michigan License No. 15410

# CORNER HISTORY RESEARCH SHEET

J-11

T34N,R2E ALLIS TOWNSHIP-NORTH PART,  
PRESQUE ISLE COUNTY, MICHIGAN.

## ACTIVITY                      MONUMENT & ACCESSORIES                      COMMENTS

GLO Survey  
July 11, 1855

Hemlock 14" N20°E 10 Links  
Hemlock 16" S67°W 11 Links

Act 74 filing by  
C. Eugene Ostling #12026  
Sept. 12, 1973, Page 22  
Corner Recordation

Set 1/2" Iron Bar  
Fence Post N37°W 5.2'  
Fence Cor. S43°40'W 5.0'  
Fence Post S40°E 5.7'

Presque Isle  
Remonumentation  
Dec. 9, 1993

FD. 1/2" Rod & Cap #12026  
and same witnesses as above  
all in poor condition & replaced  
S37°W 20.66' 3" Balsam  
S86°E 13.32' 9" Maple  
S02°E 18.45' 3" Balsam  
N14°E 20.35' 4" Maple

#3.