

1997 PRESQUE ISLE COUNTY STATE OF MICHIGAN REMONUMENTATION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

LIBER 325 PAGE 107

For corners in

Presque Isle	Located In:	Corner Code #
(County)	Belknap Twp.	
1. Public Land Survey	T <u>34</u> N R <u>5E</u>	I <u>13</u>
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

PRESQUE ISLE COUNTY
RECORDED

97 DEC 18 AM 9:57

Janet M. Lamb
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, James A. Beck, in a field survey on Oct 30, 1997 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

A. Description of original monument and accessories and/or subsequent restoration:

I 13 1840 G.L.O. by John Hodgson
"Set post Cor. Sections 34 & 35"
Beech 8 N37W 32
Beech 11 N72E 51
1856 G.L.O. by Alfred Millerd
"N53°W Corrected btwn Secs 34 & 35"
Hemlock 8 N65W 28

Sep. 22, 1978 P.A. 74 (Land Corner Recordation) Certificate page 281
by Delmer E. Porter Reg. No. 15410

Part A. No entry
Part B. "Found Axle shaft Set by F. Loud"
Part C. " 1/2" Rod & Cap in Mon. Box
N 30°E 74.65' P.Pole
S64°E 97.63', 20" Dogwood
S20°E 84.11', 6" Cedar

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I 13 Monument: found 1/2" iron rod and R.L.S. 15410 cap in monument box
Accessories:

SURVEY & S 20°E 83.88 ft., 8" Cedar (old tag grown over)
REMONUMENTATION

JAN 14 1998

SECTION


Ratified by Peer Group
in accordance with P.A. 345

Chairman *James J. Quinn*

Date 11/2/97

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

I 13 Monument: 1/2" iron rod and R.L.S. 15410 cap in monument box
Accessories:
S 20°E 83.88 ft., P.S. 21559 tag in 8" Cedar (old tag grown over)
N 36°E 76.26 ft., P.S. 21559 tag in power pole
S 59°E 116.91 ft., Northwest corner brick planter
S 50°W 141.96 ft., Northeast corner concrete block house
Corner falls at intersection of centerlines North-South-East and West blacktop roads.

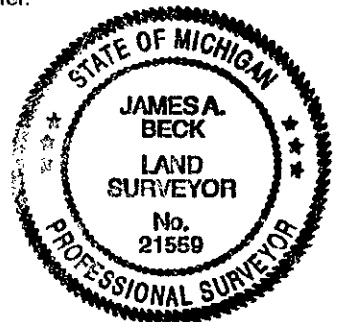

Signed by *James A. Beck*
Surveyor's Michigan License No. 21559

Date 12/18/1997