

12098

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

STATE OF MICHIGAN  
ROSCOMMON COUNTY  
RECORDED

For corners in

Roscommon  
(County)

Located In:

Corner Code #

1. Public Land Survey

T 23N R 1W

A-3

T 23N R 2W

M-3

T \_\_\_\_\_ R \_\_\_\_\_

T \_\_\_\_\_ R \_\_\_\_\_

2. Property Controlling  
in Section

S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_

S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_

3. Miscellaneous  
Property in Sec.

S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_

S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_

5. Private Claims \_\_\_\_\_

9 DEC 1999 2:33:28 PM

ROBERT W. SMITH  
REGISTER OF DEEDS

FILE IN LIBER 3 OF LAND CORNERS

Register of Deeds Stamp & File Number

I, Marvin E. Myers, in a field survey on November 22, 1999 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

G.L.O - April 1839 J. Brink, DS  
Mon - Post

Wit: 7" Maple S38°W 21 lks  
10" Birch N39°W 34 lks  
Swamp South 300 lks

GLO - 1852  
Mon - Post

Wit: 8" Aspen S64°E 20 lks  
5" W. Birch N62°E 35 lks  
18" W. Pine S85°26'E 335 lks Swamp South 100 lks

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


Found old 12" diameter Corner fence post 0.4 below surface with wire on ground running N-S and E-W; found line tree Stump Hole 227 feet East, Stump Hole is 66' North of Swamp as called for in GLO notes; measured South 200 feet to edge of swamp GLO calls for 198 feet. Set Standard County Monument in center of Post location. Accepted as a perpetuation of the Original Government Corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Mon: Standard County Corner  
Wit: Set nail and tag in West side 8" Balsam N15°E 11.03'  
Set nail and tag in South side 8" White Pine N55°E 6.54'  
Set nail and tag in South side 12" Tamarack S78°E 17.05'  
Set nail and tag in East side 12" White Pine Due South 17.35'  
Set Carsonite post West 2.5'

ROSCOMMON COUNTY  
PEER GROUP APPROVAL  
DATE NOV 30, 1999

*Marvin E. Myers*  
Marvin E. Myers, P.S.  
County Surveyor

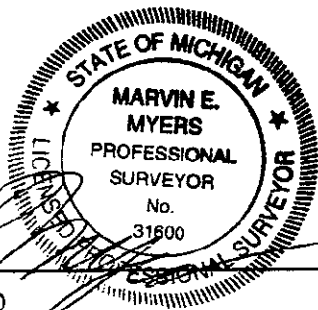

Signed by Marvin E. Myers  
Surveyor's Michigan License No. 31600

Date December 03, 1999

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 26, 1971  
REVISED MAY 14, 1975  
REVISED JAN., 1983  
REVISED OCT., 1995

LIBER 3 PAGE 630

SURVEY &  
RECORDS

NOV 14 2000

SECTION