


**LAND CORNER RECORDATION CERTIFICATE**  
**Filing Requirement of Act 74, Mich. P.A. 1970**

For corners in

<u>Roscommon</u> (County)	Located In:	Corner Code #
1. Public Land Survey	T <u>24N</u> R <u>2W</u>	<u>J-3</u>
2. Property Controlling in Section	T <u>    </u> R <u>    </u>	<u>    </u>
3. Miscellaneous Property in Sec.	S <u>    </u> T <u>    </u> R <u>    </u>	<u>    </u>
	S <u>    </u> T <u>    </u> R <u>    </u>	<u>    </u>
	S <u>    </u> T <u>    </u> R <u>    </u>	<u>    </u>

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_

5. Private Claims \_\_\_\_\_

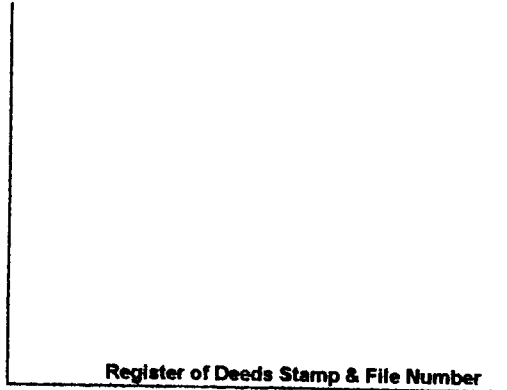

I, Carl T. Kliskila, in a field survey on June 29, 19 98 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

1	A	B	C	D	E	F	G	H	I	J	K	L	M
2		6		5		4		3		2		1	
3										●			
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

**NOTE:** Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

**A. Description of original monument and accessories and/or subsequent restoration:**

J - 3 GLO set section post - William Burt -- 1852.  
 Witness: White Pine 24° S 84.5° W 333 links

**B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:**

J - 3 Found and accepted the point of a rotted off post as set by George Henning, RLS #2240, for the Quarter Corner common to Sections 2 and 11. Henning's 1947 survey of Section 11 says, "Set pipe and post in corner from found SW U.S. BT Pine stump with mark." Found one of his NBT's, an Elm stump N 17° E at 40.3'.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

J - 3 Set 1 1/4" x 60" Iron pipe with aluminum DNR monument cap and set carsonite marker post.

Witness: Set nail in 8" Ash	N 67° W	7.84'
Set nail in 10" Ash	N 29° W	24.88'
Set nail in 12" Ash	N 30° E	53.23'
Set nail in 12" - 14" triple Ash	N 49° E	21.46'
* Old NBT Elm stump	N 17° E	40.3'

\* (Old witness by George Henning, RLS)



Signed by Carl T. Kliskila  
 Surveyor's Michigan License No. 33981

Date 8-18-98