


LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich P.A. 1970

For corners in
 Roscommon County

Located in: Corner Code #

1. Public Land Survey

T24N R3W I-1
 T R
 T R
 T R

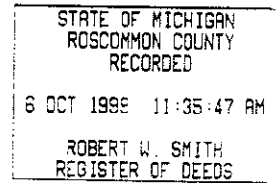

FILE IN LIBER 3 OF LAND CORNERS
 Register of Deeds Stamp & File Number

I, Larry L. Cavanagh, in a field survey July 1999, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in line 1 above was in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

A. Description of original monument and accessories and/or subsequent restoration:

JOHN BRINK, GLO 1838
 SET POST COR SECS 34 & 35
 BIRCH 10° N22°W 14 LKS
 CEDAR 8° N75°E 13 LKS

ROBERT T. OSTLING, RLS 1946
 SEC 2 SURVEY
 PAVT BOX IN CENTERLINE OF PAVT

WILLIAM BURT, GLO, 1852
 W. BIRCH 8° S49°E 12 LKS
 CEDAR 6° S29°W 26 LKS

ROBERT T. OSTLING, RLS 1946
 SEC 3 SURVEY
 PAVT BOX 1.0' SOUTH OF HWY CENTERLINE
 B.T. CEDAR S19 1/2°E 72.5'
 B.T. CEDAR S48°W 69.01'

GEORGE D. HENNING, CO. SURVEYOR 1943
 HIGHWAY MONUMENT BOX 1.0' N OF
 CENTERLINE OF PAVT
 PLACED 1 1/4" X 24' IRON PIPE ON
 ROW LINE S5°30'W 100' FROM
 PAVT CENTERLINE

FRANK J. ARLETH, PS 1997
 SURVEY L463, P384
 FD PAVT BOX 2.0' NORTH OF CENTERLINE OF RD

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

FOUND PAVT BOX, NO MONUMENT, 2.0' SOUTH OF CENTERLINE
 CHECKED DISTANCE TO H-1 2644.42'
 MDOT REF HUBS TO SOUTH 66.36' RECORDED 66.43'
 95.75' RECORDED 95.83'
 119.51' RECORDED 119.53'

THE BEST AVAILABLE EVIDENCE OF THE POSITION OF THE ORIGINAL CORNER.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

SET STANDARD MONUMENT IN PAVEMENT BOX 2± SOUTH OF CENTERLINE
 WIT: NAIL & TAG IN 11' CEDAR S9°W 65.27'
 NAIL & TAG IN 6' CEDAR S20°E 71.26'
 NAIL & TAG IN 4' BALSAM N45°E 77.38'
 NAIL & TAG IN 6' SPRUCE N3°E 88.59'
 CARSONITE POST SOUTH 41.6'

RUSCOMMON COUNTY
PEER GROUP APPROVAL
 DATE Sept 10, 1999


Marvin E. Myers
 Marvin E. Myers, P.S.
 County Surveyor



Signed by Larry L. Cavanagh Date Sept. 14, 1999
 Surveyor's Michigan License NO. 17614

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN 28, 1971

REVISED MAY 14, 1975
 REVISED JAN., 1983



LIBER 3 PAGE 621

SURVEY & REGISTER

MAR 1 2000

SECTION