


LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich P.A. 1970

For corners in
 Roscommon County

Located in: Corner Code #

1. Public Land Survey
 T24N R3W K-1
 T R
 T R
 T R

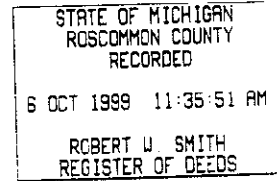

FILE IN LIBER 3 OF LAND CORNERS
 Register of Deeds Stamp & File Number

I, Larry L. Cavanagh, in a field survey July 1999, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in line 1 above was in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

A. Description of original monument and accessories and/or subsequent restoration:

JOHN BRINK, GLO 1838
 SET POST COR SECS 35 & 36
 BEECH 10' N72°W 41 LKS
 BEECH 9' N25°E 33 LKS

G. D. HENNING, RLS 1953
 "CENTERLINE OF HIGHWAY & 1/4 LINE SOUTH"
 NO MONUMENT MENTIONED

WILLIAM BURT, GLO, 1852
 HEMLOCK 20' S31°E 25 LKS
 BEECH 8' S76°W 14 LKS

FRANK J. ARLETH, 1990
 SURVEY, L339, P381
 FD PK NAIL OVER PAVT BOX
 12' ELM N20°W 74.4'
 1/2' BAR S5°51'20"W 105.0'

ROBERT T. OSTLING, RLS, 1946
 SECTION SURVEY
 BOLT IN PAVT 11.2' W OF PAVT
 BOX FOR SEC COR
 SPIKE IN ELM 24' N69°E 75.0'
 SPIKE IN ELM 12' N29°W 74.4'

LARRY L. CAVANAGH, PS SURVEY 1997
 SET PK NAIL FROM WIT AND SURVEYS OF RECORD
 1/2' BAR S5°51'53"W 105.0'
 P. POLE N17°W 94.04'
 12' W. PINE N68°E 138.84'
 6' J. PINE S36°E 63.27'
 P. POLE S27°W 110.50'

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

LARRY L. CAVANAGH, PS 1998
 FD PK NAIL
 WITNESS SAME AS ABOVE

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

IN 1997 A PK NAIL WAS SET AT CORNER LOCATION BY MEASUREMENT FROM PREVIOUS SURVEYS OF RECORD
 ALL 1997 WITNESSES WERE RECOVERED (PK NAIL NOT FOUND)
 CORNER SET FROM 1997 WITNESSES

A CAREFUL AND FAITHFUL ESTABLISHMENT OF THE POSITION OF THE CORNER.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

SET STANDARD MONUMENT IN PAVEMENT BOX 4' ± NORTH OF CENTERLINE OF M-76, 2' ± EAST OF THE CENTERLINE OF NOLAN ROAD
 WIT: NAIL & TAG IN P. POLE N17°W 94.04'
 NAIL & TAG IN 12' W. PINE N68°E 138.84'
 NAIL & TAG IN 6' J. PINE S36°E 63.27'
 NAIL & TAG IN P. POLE S27°W 110.50'
 1/2' BAR S5°52'W 105.0'
 CARSONITE POST N35°W 53.35'

ROSCOMMON COUNTY
PEER GROUP APPROVAL
 DATE Sept 10, 1999

Marvin E. Myers
 Marvin E. Myers, P.S.
 County Surveyor



Signed by Larry L. Cavanagh Date Sept. 14, 1999
 Surveyor's Michigan License NO. 17614

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN 28, 1971
 REVISED MAY 14, 1975
 REVISED JAN., 1983



RECEIVED & RECORDED

MAR 11 2000

SECTION