

1993

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970

COMMISSION

COMMISSION

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____ T. <u>12</u> N. S., R. <u>4</u> E. W.		C-13
2. PROPERTY CONTROLLING IN SECTION _____ , T. _____ N. S., R. _____ E. W.		
3. MISCELLANEOUS PROPERTY IN SECTION _____ , T. _____ N. S., R. _____ E. W.		
4. LOT NO. _____ , RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

RECORDED & FILED
Lib 6 Page 179
 DEC 22 2 13 PM '93
 MICHIGAN STATE BOARD OF REGISTRATION
 REGISTER OF DEEDS
 SAGINAW COUNTY MICH.
 REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Duane F. Ledy, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on September, 1993, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on September, 1993, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:
 Wood post set in 1822 by Wampler at 80.00 chains. Closing corner C-1, T11N, R4E set at 3.5 links West of Standard corner, per Wampler. No evidence of original monument or subsequent restoration of C-13.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:
 C-1 for Township 11 North established for Birchview Park #1 in 1961 has been accepted as closing corner. C-13 set at GLO call of 3.5 links (2.31') East of established closing corner. Placement ratified by Saginaw County Remonumentation Peer Group Review on October 7, 1993.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
 Set 5/8" rod and Sag. Co. Remon. 3" brass cap in monument box.
 S 45 E 38.79 Nail and brass tag marked "P.S. 21575" in W. side 12" W. Pine
 S 88 E 24.59 Nail and brass tag marked "P.S. 21575" in S. side of util. pole
 N 45 W 44.52 Nail and brass tag marked "P.S. 21575" in E. side 24" Maple
 N 88 W 59.49 Nail and brass tag marked "P.S. 21575" in N. side of power pole
 West 2.31 1/2" rod; corner C-1, T11N, R4E


SIGNED BY Duane F. Ledy DATE Dec. 22, 1993

SURVEYOR'S MICHIGAN REGISTRATION NO. 21575

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR

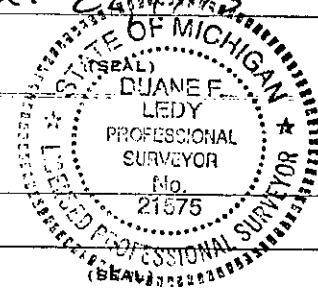

SURVEYOR'S MICHIGAN REGISTRATION NO. _____