

RECEIVED
REGISTER

ST. CLAIR COUNTY, MICHIGAN
OFFICIAL GOVERNMENT CORNER



SEP 20 PM 2:23

REGISTER OF DEEDS
ST. CLAIR COUNTY

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

	Located In:	Corner Code --#
	Kimball Township	
1. Public Land Survey	T <u>6N</u> R <u>16E</u>	<u>B-1</u>
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	<u>Seg # 1</u>
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

I, John C. Niederhauser in a field survey on March 15, 19 94, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	13	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

NOTE: Not more than 1 corner, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

This corner was not set during original Government survey. Monument box listed on Old Surveyor's Record of St. Clair County. Corner recovered and recorded by L. Thomas, Liber 2, page 247, P.K. nail listed. Corner recovered and recorded by D. Hooth, Liber 3, page 414, monument box with 3/4" pipe.

STATE PLAIN COORDINATES

N. _____

E. _____

ELEVATION _____

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found capped iron #19835 in monument box on centerline of existing Lapeer Road pavement. None of the recorded witnesses were found. Verified corner from old Michigan Department of Transportation Road Plans and from recorded survey, Liber 8, page 127 and from unrecorded surveys of G. James, C. McDaniel, M. Rossow, V.T.A. and B.M.J.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:


Capped iron #19835 in monument box. Located 0.41 feet south of the true Township line.

S 30°E 28.80' to set P.K. nail with county remon tag in top of guard rail post
 S 30°W 62.25' to set P.K. nail with county remon tag in S.E. side of bell riser pole
 N 20°W 85.60' to set P.K. nail with county remon tag in W. side of twin elm tree
 N 20°E 83.90' to set P.K. nail with county remon tag in E. side of 8" elm tree
 WEST 2685.56' to N.W. corner Section 6, T6N-R16E
 EAST 2663.44' to N.E. corner Section 6, T6N-R16E

Signed by John C. Niederhauser
 Surveyor's Michigan License No. 24608

PA 345-1990 Date _____
 PEER COMMITTEE

APPROVED 6-17-94

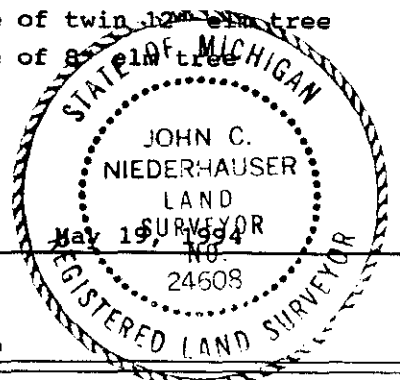

APPROVED AS AN OFFICIAL GOVERNMENT CORNER BY ST. CLAIR COUNTY:

Signed By: _____
 St. Clair County Land Surveyor

Date

LIBER 007 PAGE 362

Surveyor's Michigan License No.