

DEC 02 1997

COMMISSION

ST. CLAIR COUNTY, MICHIGAN
OFFICIAL GOVERNMENT CORNER

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970



REGISTERED
NOV 21 AM 7:25
ST. CLAIR COUNTY

	Located In:	Corner Code #
1. Public Land Survey	KIMBALL TWP. T 6N. R 16E.	C-13
2. Property Controlling in Section	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, Michael J. Rossow, in a field survey on April 09, 1997, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 1 CORNER, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:
A POST WAS SET FOR THIS CORNER IN ORIGINAL GOVERNMENT SURVEY (1817) WITH 2 WITNESSES A 14" BEECH BEARING N.74°E. 19 LINKS AND A 12" BEECH BEARING N.23°W. 15 LINKS, BOTH OF WHICH ARE GONE. OLD ST. CLAIR COUNTY SURVEYOR'S RECORD SHOWS NOR WITNESSES NOTHING. ACT 74 CORNER CERT. FILED IN L.2,P.366 SETS A CONCRETE MONUMENT FOR THE CORNER (1974), A SUBSEQUENT RECORDED SURVEY IN L.6,P.124 FINDS A DIFFERENT CORNER (1978) AND WITNESSES IT AS A 3/4" PIPE 19.50' WEST AND 16.1' NORTH OF MONUMENT. ACT 74 CERT. FILED IN L.8,P.256 SETS A "T" IRON (1996) IN PLACE OF THE "3/4" PIPE".


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
FOUND 3/4" PIPE 19.50' WEST & 16.1' NORTH OF A CONCRETE MONUMENT AND VERIFIES WITNESSES FROM L.8,P.256 ACT 74 CERTIFICATE. ACT 74 CERTIFICATE L.6,P.133, NW 67.94' TO PK IN 24" MAPLE: FOUND AND VERIFIED. NNW 70.37' TO PK IN 8" POPPLE: FOUND AND VERIFIED. ENE 59.79' TO RED TOP MON.: FOUND AND VERIFIED. EAST 92.95' TO N. 1/4 COR. SEC. 6 ST. CLAIR TWP.: FOUND AND VERIFIED. NE 58.22' TO COR. FENCE POST: FOUND AND VERIFIED. WNW 67.85' TO PK IN (SW) 30" OAKN. 41.0± TO PIPELINE X-ING: FOUND AND VERIFIED. ACT 74, CERT. L8,P.256, ENE 59.30' TO F.C.M.: FOUND AND VERIFIED. NW 68.20' TO PK NAIL IN 24" MAPLE: FOUND AND VERIFIED. SW 52.80' TO SET PK CAP IN 8" CRIMSON MAPLE: FOUND AND VERIFIED.

PA 345-1990
PEER COMMITTEE

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
SET A 2" DIA. ALUMINUM CAP WITH MAGNET ATTACHED & INSCRIBED "ST. CLAIR COUNTY OFFICIAL CORNER" ON THE EXISTING "T" IRON.
S.86°43'25"W. 2620.50' TO S. 1/4 COR. SEC. 31, STATE PLANE COORDINATES
N.87°25'10"E. 2657.90' TO S. 1/4 COR. SEC. 32, STATE PLANE COORDINATES
92.98' WEST OF THE N.E. CORNER OF SEC. 6, T.5N.,R.16E.
SW 52.82' PK AND COUNTY TAG IN 12" CRIMSON MAPLE
WNW 68.06' PK AND COUNTY TAG IN 30" MAPLE
NNW 118.15' PK AND COUNTY TAG IN 24" TWIN MAPLE
NE 111.98' PK AND COUNTY TAG IN 10" TWIN ELM

APPROVED 7-11-97

DES

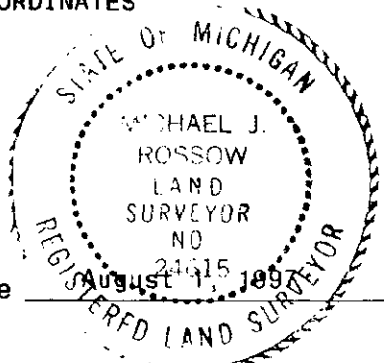

Signed by _____ Michael J. Rossow Date _____
Surveyor's Michigan License No. 24615