

FILED

JUN 27 12 47 PM '94

004 PG 041

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

REGISTER OF DEEDS  
ST. JOSEPH TOWNSHIP

For corners in

ST. JOSEPH  
(County)

Located In:

Corner Code #

- 1. Public Land Survey T 5S R 10W K-9
- 2. Property Controlling in Section S T R
- 3. Miscellaneous Property in Sec. S T R

**SURVEY & REMONUMENTATION**

Register of Deeds Stamp & File Number

- 4. Lot No. \_\_\_\_\_, Recorded Plat AUG 31 1994
- 5. Private Claims \_\_\_\_\_

COMMISSION

A	B	C	D	E	F	G	H	I	J	K	L	M
2	5	5	4	3	2							
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

I, WAYNE A. MOSTROM, in a field survey on MAY 13, 19 94, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

K-9  
1864 SURVEY BY GARDNER  
SET STONE FROM OLD BEARINGS  
40' W.O. = S81°W 94 LKS  
8" B.O. = S18°E 125 3/4 LKS

1974 LORC (3/11) BY SAYERS  
PINCHED PIPE IN MON. BOX  
NAIL @ N. SIDE POLE = NW 38.2'  
NAIL @ N. SIDE 32" OAK = NE 37.8'

1899 SURVEYS BY REED (2)  
STONE BY FORMER SURVEYOR 13" B.O. = N22°E 1.04 CH  
23" B.O. = S21°50'E 1.24 2/3 LKS

SURVEY  
3/4" PIPE IN MON. BOX  
P.P. = N45°W 38.3', P.P. = S50°W 33.95'  
P.P. = N35°E 30.1', 16" OAK = S40°E 43.6'


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

K-9  
FOUND PINCHED PIPE OVER STONE IN MON. BOX  
BURR OAK = S18°E 125 3/4 LKS  
P.P. = NW 38.2  
OAK = NE 37.8'  
P.P. = N45°W 38.3'  
P.P. = N35°E 30.1'  
16" OAK = S40°E 43.6'

RATIFIED BY PEER GROUP  
IN ACCORDANCE WITH P.A. 345  
ON JUNE 13, 1994  
W. Allen CO. REPRESENTATIVE

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

K-9  
SET 5/8" X 12" BAR WITH STD. CAP OVER STONE IN MON. BOX  
N & W IN NE SIDE P.P. = N45°W 38.2'  
N & W IN NW SIDE P.P. = N46°E 30.1'  
N & W IN SE SIDE 48" OAK = N56°E 37.44'  
N & W IN SW SIDE 18" TRI-OAK = S40°E 43.6'  
N & W IN SE SIDE P.P. = S26°W 66.70'

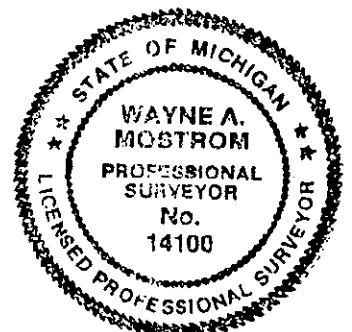

Signed by Wayne A. Mostrom  
Surveyor's Michigan License No. 14100

Date 6/15/94

**REMONUMENTATION**