

# LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970  
SCHOOLCRAFT CO. 3 CORNERS

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. _____ N. _____ S. _____ R. _____ E. _____ W. _____	_____
2. PROPERTY CONTROL- ING IN SECTION <u>24</u>	T. <u>42</u> S. <u>16</u> R. <u>16</u> W. <u>XX</u>	<u>1-8, 4, 8</u>
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ N. _____ S. _____ R. _____ E. _____ W. _____	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Gerald L. Wiggins, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 7-19, 1987, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_, 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

- 1-8 Center Corner of Section 24. Not previously set.
- 4 N.W. 1/16 Corner of Section 24. Not previously set.
- 8 West 1/16 Corner of Section 24. Not previously set.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- 1-8 Corner set at intersection of N-S and E-W 1/4 lines of Section 24 by closed traverse.
- 4 Corner set at center of NW 1/4 of Section 24 by closed traverse.
- 8 Corner set midpoint on line between West 1/4 Corner and Center of Section 24.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:  
DNR Monuments set at all three corners.

- |                                  |                            |                           |
|----------------------------------|----------------------------|---------------------------|
| <u>1-8</u> Sq. Post, South, 0.6' | 4 12" Cedar, N15°W, 61.85' | 8 12" Spruce, N17°E, 7.8' |
| 3" Balsam, S47°W, 26.7'          | 8" Cedar, S66°E, 5.45'     | 5" Cedar, N45°E, 32.5'    |
| 3" Balsam, West, 47.7'           | 4" Cedar, S80°W, 7.75'     | 6" Cedar, S5°E, 31.0'     |
| 6" Spruce, N40°E, 30.9'          | 6" Cedar, N58°W, 8.75'     | 6" Cedar, N20°W, 16.7'    |


SIGNED BY Gerald L. Wiggins DATE 2-3-88  
Gerald L. Wiggins 23521

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
MICHIGAN REGISTERED LAND SURVEYOR

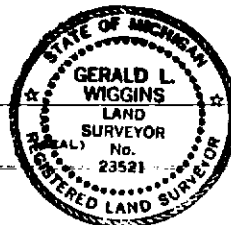

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_

FORM APPROVED BY MICHIGAN STATE BOARD OF REGISTRATION, JAN. 28, 1971  
REVISED MAY 14, 1978

MAY PLACE SKETCH ON BACK OR ATTACHED SHEET