

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Schoolcraft
 (County)

Located In:

Corner Code #

- | | | |
|------------------------------------|-------------------------|-------|
| 1. Public Land Survey | T 45N R 16W | B1 |
| | T 45N R 16W | C1 |
| | T _____ R _____ | _____ |
| | T _____ R _____ | _____ |
| 2. Property Controlling in Section | S _____ T _____ R _____ | _____ |
| | S _____ T _____ R _____ | _____ |
| 3. Miscellaneous Property in Sec. | S _____ T _____ R _____ | _____ |
| | S _____ T _____ R _____ | _____ |

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

Jul 05 2000

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

A. Description of original monument and accessories and/or subsequent restoration:


- (B1) Quarter corner common to Section 6, T45N-R16W and Section 31, T46N-R16W. Previously remonumented from original B.T. by Billy D. Buckler, RLS, in 1961. 1" Iron pipe with 4" brass cap. 5" W. Pine N60E 64.5 links, 4" W. Pine N65W 62.5 links.
 (C1) Corner common to Sec. 5-6 T45N-R16W and 31-32 T46N-R16W. Reestablished by single proportionate measurement and monumented in 1963 by F.J. Bray, RLS. 1" Iron pipe with 4" aluminum cap. 5" Spruce N18W 4 links, 16" W. Pine S85E 51 links.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

- (B1) Recovered the 1961 monument, a 1" ID iron pipe capped with a 4" brass Michigan Dept. of Conservation tablet, in good condition, and at record bearing and distance from the remaining NBT, W.Pine NW, now 12" dia. Left the monument in place.
 (C1) Recovered the 1963 monument, a 1" ID iron pipe capped with a 4" dia. aluminum Michigan Dept. of Conservation tablet, in good condition, and at record bearing and distance from the NBT W.Pine, SE, now 30" diameter. Left the monument in place.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- | | |
|---|--|
| (B1) Found 1" pipe with 4" brass cap.
Blazed, scribed, and set measuring nails in the following:
6" W. Pine N40E 9.35' "1/4S NBT"
5" Maple East 13.85' do
5" W. Pine S53E 16.1' do
The 1961 wit:
12" W. Pine N62W 41.35' do
Bearings are magnetic. Distances to nail with tag. | (C1) Found 1" pipe with 4" Alum. cap.
Blazed, scribed, and set measuring nails in the following:
14" W. Pine West 56.5' "S6 NBT"
14" W. Pine N88W 53.4' "S31 NBT"
8" Spruce N70W 44.2' "S31 NBT"
the 1963 wit:
30" W. Pine S80E 34.7' "S5"
Bearings are magnetic. Distances are to nail with tag. |
|---|--|

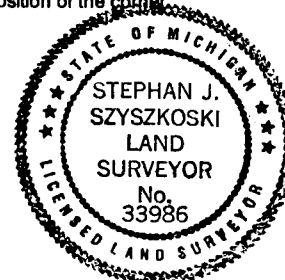

Signed by Stephan J. Szyszkoski
 Surveyor's Michigan License No. 33986

Date 8/29/00

For the Michigan Department of Natural Resources - Forest Management Division