

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970

SCHOOLCRAFT CO.

2 CORNERS.

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>46</u> N. <u>XX</u> R. <u>13</u> <u>XX</u>	<u>I-3, K-1</u>
2. PROPERTY CONTROLLING IN SECTION _____	T. _____ S. _____ R. _____ E. _____ W. _____	_____
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ S. _____ R. _____ E. _____ W. _____	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Gerald L. Wiggins, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 4-27 & 5-9, 1988, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

- A. Description of original monument and accessories and/or subsequent restoration:
- I-3 S.W. Sec. Cor. of Sec. 2. Corner placed by Billy D. Buckler R.L.S. on 7-19-60. DNR Monument with 6" Balsam, S80°W, 8 lks. & 5" Soft Maple, South, 42 1/2 lks.
- K-1 N.E. Sec. Cor. of Sec. 2. Corner placed by Billy D. Buckler R.L.S. on 9-9-52. DNR Monument with 34" W. Pine Stump, N41°E 12 links.


B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- I-3 Witnessed Buckler's Corner 6" Balsam is dead.
- K-1 Witnessed Buckler's Corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- DNR Monuments
- I-3 Buckler's 5" Soft Maple, South, 28.05' & 6" Twin Maple, S45°W, 19.1' & 6" Maple, S55°E, 27.6" & 8" Maple, S18°E, 19.7'.
- K-1 Buckler's 34" W. Pine Stub, N41°E, 7.92' & 10 W. Pine, S10°E, 49.6' & 6" J. Pine, S85°E, 27.0' & 6" J. Pine, N68°E, 17.2'.

SIGNED BY Gerald L. Wiggins DATE 6-30-88
 Gerald L. Wiggins
 SURVEYOR'S MICHIGAN REGISTRATION NO. 23521

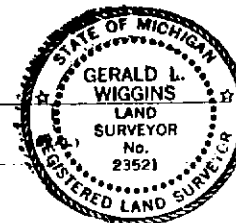

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____

FORM APPROVED BY MICHIGAN STATE BOARD OF REGISTRATION, JAN. 28, 1971
 REVISED MAY 14, 1978

MAY PLACE SKETCH ON BACK OR ATTACHED SHEET