

57

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Schoolcraft

(County)

Located In:

Corner Code #

1. Public Land Survey

T 47N R 14N C9

T 47N R 14N E9

T R

T R

2. Property Controlling
in Section

S T R

S T R

3. Miscellaneous
Property in Sec.

S T R

S T R

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

May 13 1997

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

A. Description of original monument and accessories and/or subsequent restoration:

(C9) Corner common to Sections 19-20-29-30. Corner perpetuated in the original position by F.J. Bray in 1953 from the remains of the original bearing trees. New monument is 1" pipe with 4" brass cap. Bray's witnesses are 28" W. Pine stump N06E 25 links, 24" W. Pine stump S59E 52 links.

(E9) Corner common to Sections 20-21-28-29. Corner remonumented in 1960 by Billy D. Buckler: "This corner was replaced from one probable B.T. a W. Pine stump bottom bearing N47W 21 links. Position checks to corners in all directions. Corner lies 1.00 chains east of road". Bray placed a 1" pipe with a 4" brass cap and marked the following: 48" W. Pine stp. N05W 63.5 links, 15" W. Pine stp. S17W 81 links, 14" W. Pine stp. S77W 28 links.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(C9) Recovered the 1953 monument as described, a 1" ID iron pipe capped with a 4" dia. cast aluminum MI Dept. of Conservation tablet, in good condition, and at record bearing and distance from the 1953 witnesses, both recovered with scribing and measuring notch visible. Found no surface evidence of the original 8T's. Left the monument in place and marked four new witnesses, as described below. Corner recovered and re-witnessed by T. Stark and D. Lampela, Newberry District Office. The corner lies on the west edge of a N-S road from which a trail proceeds easterly.

(E9) Recovered the 1960 monument as described, a 1" ID iron pipe capped with a 4" dia. brass MI Dept. of Conservation cap, in good condition, and at record bearing and distance from all three W. Pine stump witnesses, all found with scribing plain. Accepted the monument as a careful and faithful perpetuation of the position of the original corner. Left the monument in place and marked four new accessories as described below. Corner recovered and re-witnessed by T. Stark and D. Lampela, Newberry District Office. The corner lies about 90' east of a road.


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(C9) Found 1" pipe with 4" brass cap.
Blazed, scribed, and set measuring nails
in the following:

10" Maple in clump S51E 51.6' "S29 NBT"
7" Jack Pine N44E 61.65' "S20 NBT"
7" Jack Pine West 82.60' "S19 NBT"
7" Jack Pine S58W 109.95' "S30 NBT"
Placed a 5" squared and scribed cedar
post adjacent. Bearings are magnetic.

(E9) Found 1" pipe with 4" brass cap.
Blazed, scribed, and set measuring nails
in the following:

10" R. Pine S19W 9.8' "S29 NBT"
13" R. Pine N86W 9.7' "S20 NBT"
Twin 8" R. Pine S19E 8.65' "S28 NBT"
14" R. Pine N73E 87.0' "S21 NBT"
Placed a 5" squared and scribed cedar
post adjacent. Bearings are magnetic.

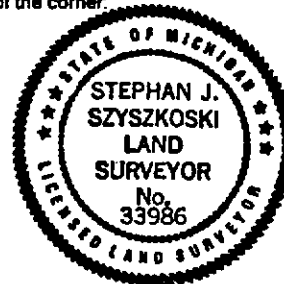

Signed by

Stephan J. Szyszkoski

Date

3/25/98

Surveyor's Michigan License No.

33986

For the Michigan Department of Natural Resources - Forest Management Division