

SURVEY & REMONUMENTATION

DEC 15 1993

COMMISSION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

RECORDED

93 DEC -6 AM 10:59

For corners in
 Shiawassee

REMONUMENTATION

(County)	Located In:	Corner Code #
1. Public Land Survey	6N 1E	K-11
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

REGISTERED
James S. Miller
 SHIawassee COUNTY, MICH.

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

I, Norman C. Caldwell, in a field survey on November, 1993, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	16	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

K-11 Sec. cor., 25, 26, 35 & 36, T6N-R1E

Wood post placed by J. Wampler, 1826, S10°E 21 1/2 lks. (14.19') 12" W. Oak N39°E 9 lks. (5.94') 9" W. Oak
 Survey by E. Mason, Co. Surveyor, 1868, recorded in Book A, pgs. 20 & 21 No monument given S17°W 69 lks. (45.54') 24" B. Oak
 Unrecorded Survey by A. F. Miller, 1981, 3rd rerod w/cap at anchor post North 14.84' N & T 20" Wild Cherry N45°E 5.62' N & T 15" Oak S03°E 12.70' N & T 4" Elm West 0.35' N & T Wood anchor post

Surveys by L. A. Bryan, 1986 - 1988, recorded in L. 2, pg. 478 of Corners and L. 5, pgs. 477, 478, 676, & 677.
 Fnd. 1/2" bar & cap #12024 E. side corner post at 4 way fence inter.
 N50°E 5.60' Fnd. N & W SE side 18" Oak
 South 12.45' Set N & T W. side 8" Elm
 North 14.80' Fnd. N & W SE side 24" Cherry

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

K-11 Sec. cor., 25, 26, 35 & 36, T6N-R1E


Fnd. 1/2" rod w/cap #12024 E. side corner post at 4 way fence inter. per L. 2, pg. 478 of Corners and L. 5, pgs. 477 & 478 & 676 & 677. Replaced with a standard 20" Harrison marker as approved by the Shiawassee County Peer Review Group and is accepted as the best available evidence of the position of the original corner.

NOTE: No evidence was found of County Surveyor's references, but dimensions on lines fit with consistent ratio.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

K-11 Sec. cor., 25, 26, 35 & 36, T6N-R1E

Fnd. 1/2" rod w/cap #12024 E. side corner post at 4 way fence inter. per L. 2, pg. 478 of Corners and L. 5, pgs. 477 & 478 & 676 & 677. Replaced with a standard 20" Harrison marker as approved by the Shiawassee County Peer Review Group and is accepted as the best available evidence of the position of the original corner.
 N50°E 5.54' Fnd. N & T SE face 18" Oak (R)
 South 12.71' Set N & T W. side 8" Elm (R - tree)
 North 15.04' Set N & T E. side 24" Cherry (R - tree)
 N30°E 6.70' Set N & T W. side 16" Oak

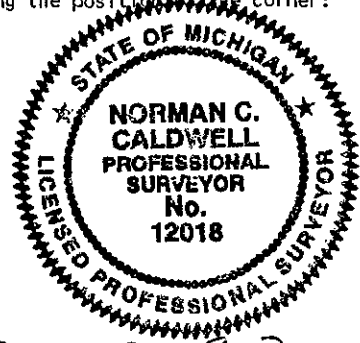

Signed by *Norman C. Caldwell* Date 2 DEC 93
 Surveyor's Michigan License No. 12018