

SURVEY & REMONIMENTATION

FEB 08 2001

2000 REMONUMENTATION

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

SECTION

For corners in: **MILLINGTON TWP.**

<u>TUSCOLA</u> (County)	Located In:	Corner Code #
1. Public Land Survey	T <u>10N</u> R <u>08E</u>	<u>K-4</u>
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, JONATHAN M. FIELD, in a field survey on AUGUST 17 2000, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:
1822 GLO; FLETCHER, D.S.; SET POST; BEECH 6 S49E 23 LKS., SUGAR 10 S69E 31 LKS.
1894 FELTON, C.S.; POST AND CROCKERY; W.OAK 4 S66W 64 LKS.
1971 ROWE ENG.; ROWE, P.S. #11192; SURVEY L.1 PG.152; FND. BOAT SPIKE IN MON BOX; N15°E159.04' PK NAIL IN P.POLE, N75°W 41.37' NAIL W/CAP IN T.POLE, S75°E 59.05' NAIL W/CAP IN T.POLE.
1972 KAY ENG.; KAY, P.S. #14096; SURVEY L.1 PG.498; NO OBJECT STATED; SAME WITS AS 1971 SURVEY
1972 KAY ENG.; KAY, P.S. #14096; SURVEY L.2 PG.157; NO OBJECT STATED; SAME WITS AS 1971 SURVEY
1973 ROWE ENG.; ROWE, P.S. #11192; LCRC PG.18; SAME OBJECT AND WITS AS 1971 SURVEY
1973 KAY ENG.; KAY, P.S. #14096; SURVEY L.437 PG.277; NO OBJECT STATED; SAME WITS AS 1971 SURVEY
1973 KAY ENG.; KAY, P.S. #14096; SURVEY L.449 PG.528-9; SAME OBJECT AND WITS AS 1971 SURVEY
1974 KAY ENG.; KAY, P.S. #14096; SURVEY L.438 PG.475; SAME OBJECT AND WITS AS 1971 SURVEY
1985 ROWE ENG.; OWENS, P.S.#20709; SURVEY L.558 PG.711-6; FND. BOAT SPIKE IN MON BOX; N15°E 159.04' P.POLE, S75E 59.13' T.POLE, N75W 41.16' T.POLE, N40E 61.16' 9" CH. ELM
1992 GRAVLIN LAND SURVEY; GRAVLIN, P.S. #23510; SURVEY L.637 PG.766; FND. BOAT SPIKE IN MON BOX; N15°E 159.04' PK NAIL IN P.POLE, N30°E 61.0' 20" ELM, N50°W 41.60' 6" BOX ELDER.
1993 ROWE ENG.; FIELD P.S. #37276; SURVEY L.644 PG.323; FND. BOAT SPIKE IN MON BOX; N85°W 41.68' NAIL IN NE FACE OF 6" BOXELDER, N40°E 60.94' NAIL SE FACE 24" ELM, N15°E 156.99' NAIL AND TAG #37276 W FACE P. POLE, WEST 0.25' PHYS. C/L SHERIDAN ROAD.
2000 DAVIS LAND SURVEYING; HAY, P.S.#41101; UNRECORDED SURVEY JOB NO.00060 DATED 5-22-00; FND. BOAT SPIKE IN MON BOX; SAME WITS AS 1992 GRAVLIN SURVEY ADDED EAST 33.00' IRON W/CAP #23510

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
2000 ROWE; FIELD, P.S.#37276; FND BOAT SPIKE IN MON BOX; 0.6' W. OF C/L SHERIDAN RD., TREE LINE TO W., NO DEFINITE OCCUPATION TO E.; RECOVERED 1 PREVIOUS WIT WHICH INDICATES THAT FND. IS IN SAME POSITION AS 1985 SURVEY CITED IN SECTION A. ABOVE. **BOAT SPIKE**
BOAT SPIKE
ACCEPTED FND. IN MON. BOX AS BEST AVAILABLE EVIDENCE OF ORIGINAL CORNER POSITION.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
K-4 SET 5/8" ROD W/ REMON CAP STAMPED K-4 T10N R8E OVER FND. BOAT SPIKE, ENCASED ROD & CAP IN CONC. IN MON BOX
N40°E, 60.95' SET NAIL W/REMON TAG IN W. FACE 26" ELM
N85°W, 41.68' NAIL IN NE FACE 10" BOXELDER
N45°W, 53.53' NAIL IN NE FACE 10" ELM
N15°E, 156.99' NAIL W/TAG #37276 W. FACE P.POLE
S20°W, 217.25' SET P-K NAIL W/REMON TAG IN E. FACE P.POLE


Signed by Jonathan M. Field Date 11-10-2000
Surveyor's Michigan License No. 37276

APPROVED 11/8/2000
KML
RLB

RECEIVED FOR RECORD
LIBER NO. _____ PAGE NO. _____
FILE NO. #105 Millington
00 DEC 20 PM 2:42
Jonathan M. Field
TUSCOLA COUNTY
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

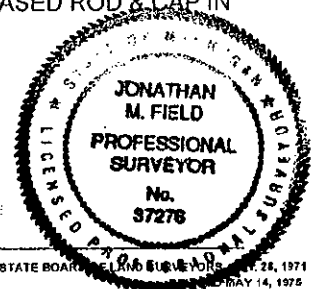

FORM APPROVED BY MICHIGAN STATE BOARD OF SURVEYORS MAY 14, 1975
REVISED JAN., 1983
ADAPTED FOR WORD PROCESSING MARCH, 1993

COPY

SURVEY &
REMONIMENTATION

FEB 08 2001

SECTION

COPY

K-4 T10N-R8E

