

1999/2000 REMONUMENTATION PROGRAM
 LAND CORNER RECORDATION CERTIFICATE
 Filing Requirement of Act 74, Mich. P.A. 1970

For corners in Watertown Township

Tuscola (County)	Located In:	Corner Code #
1. Public Land Survey	T10N R9E	K-10
	T R	
	T R	
	T R	
2. Property Controlling in Section	S T R	
	S T R	
3. Miscellaneous Property in Sec.	S T R	
	S T R	

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

Lionel Roy Emery
 I, P. S. #24593, in a field survey on Aug. 27, 1999 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

RECEIVED FOR RECORD
 LIBER NO. _____ PAGE NO. _____
 FILE NO. #81 Watertown Twp
 00 NOV -9 AM 9:43
 TUSCOLA COUNTY
 REGISTER OF DEEDS

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

A. Description of original monument and accessories and/or subsequent restoration:

Aug. 1, 1834, G.L.O. Notes by H. Burnham, D.S. Set 1/4 section post, Beech 14" S81°W 38 links, Beech 18" N67°E 30 links. Mar. 1, 1882 (recording date) map of the Village of Fostoria, surveyed by Charles Holmes, Surveyor, recorded in Liber 1 of Plats on Pages 45A & 46A, no mention of object found or set, North 59.6' to centerline of Genesee Street, South 2641.6' to corner K-11. April 18, 1899 Survey of Section 26 by G. B. Felton, County Surveyor, no mention of object found or set or accessories. Jan. 17, 1900 (date of recording) map of W. W. Crapo's Addition to the Village of Fostoria, surveyed by Wm. B. Sears, Surveyor, recorded in Liber 1 of Plats on Page 7B, iron rod at corner, N01°19'W 59.6' to iron rod at centerline of Genesee Street West, N01°19'W 1320.8' to iron rod at 1/8 post. Sec. A con't on back of form.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
 Found 3/4" iron pipe & 1" square iron bar at 1.5' below road surface beneath pipe. Accepted pipe & square iron bar as the best evidence of the original corner position.


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
 Removed pipe and square iron bar and perpetuated with concrete monument with standard brass cap stamped Corner K-10, T10N-R9E. Placed monument box over concrete monument.
 North 27.08' found 1/2" iron rod.
 N75°E 31.68' set remon. tag & spike in SE face street light guy pole.
 S60°W 72.04' NE corner church building (71.28' in 1906 by Brumley).
 N60°W 25.55' set remon. tag & spike in SW face street light pole.

Due to the untimely illness of Mr. Emery, I Kenneth D. Dunton, P.S. #23503, have reviewed Mr. Emery's field notes and have prepared this form.

Signed by Kenneth D. Dunton
 Surveyor's Michigan License No. 23503

Date Nov. 11, 2000

APPROVED
 11/6/2000
 JML
 RLB

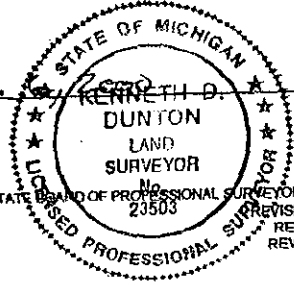

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
 REVISED MAY 14, 1975
 REVISED JAN. 1983
 REVISED OCT., 1985

SURVEY & REMONUMENTATION

COPY

FEB 08 2001

SECTION

