SURVEY & REMONUMENTATION

FEB 08 2001



SECTION

2000 REMONUMENTATION PROGRAM LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

RECEIVED FOR RECORD
LIBER NO. PAGE NO.
FILE NO # 115 V assar

00 DEC 19 PH 1: 34

JOHN MORNING
TUSCOLA COUNTY
BEGISTES OF DEEDS

Register of Deeds Stamp & File


4. Lot No. ______ , Recorded Plat

5. Private Claims

Property in Sec.

I, <u>Kari M. Lohela</u>, in a field survey on <u>October 26</u>, 20 <u>00</u> do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

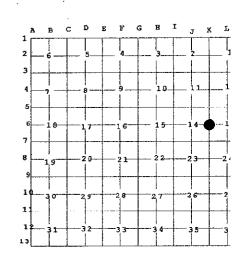

A. Description of original monument and accessories and/or subsequent restoration:

____ T____ R

1822 G.L.O., JOSEPH FLETCHER, D.S., SET 1/4 SECTION POST, PINE 16 S 16 W 4, PINE 20 N 83 W 21

NOV. 30, 1972, SURVEY L.2 P.222, LLOYD MCGINNIS, PS 18999, RE-SET PK NAIL, EAST 29.72' TO COR FENCE POST, WEST 49.48' TO P.P., S30°W 59.65' TO 10" ASH, WEST 4.86' TO PHY. CENTERLINE OF ROAD

MARCH 31, 1973, LCRC P.14 VASSAR TWP., EUGENE GOSS, PS 16040, FOUND SAME OBJECT AND ΛCCESSORIES AS SURVEY L.2, P.222

APRIL 3 1974, SURVEY L.445 P.761, DAVID ROWE, PS 11192, FOUND SAME OBJECT AND ACCESSORIES AS SURVEY L.2, P.222

AUG. 4, 1977, SURVEY L.477 P.276, KENNETH DUNTON, PS 23503, FOUND ½" RE-ROD, WEST 5.83' TO FOUND NAIL IN CENTERLINE OF PAVEMENT, WEST 49.43' TO RLS 11192 TAG IN P.P., S45°W 59.55' ASH W/RLS 11192 TAG, S30°W 77.58' TO RLS 11192 TAG IN 9" ASH

AUG. 26, 1977, LCRC P. 40 VASSAR TWP., KENNETH D. DUNTON, PS 23503, FOUND ½" RE-ROD, WEST 5.83' TO FOUND NAIL IN CENTERLINE OF PAVEMENT, WEST 49.43' TO RLS 11192 TAG IN P.P., S45°W 59.55' TO 12" ASH W/RLS 11192 TAG, S30°W 77.58' TO RLS 11192 TAG IN 9" ASH, S50°E 101.70' TO RLS 11192 TAG IN 10" WHITE PINE

SEPT. 19, 1980, SURVEY L.509 P.96, JAN FOKENS, PS 21567, FOUND ½" RE-ROD, WEST 5.83' TO FOUND NAIL IN CENTERLINE OF PAVEMENT, WEST 49.43' TO RLS 11192 TAG IN P.P., S45°W 59.55' TO 12" ASH

JUNE 13,1986, SURVEY L.565 P.1321, JACK OWENS, PS 20709, FOUND SAME OBJECT AND ACCESSORIES AS LCRC P. 40 VASSAR TWP.

AUG. 27, 1986, SURVEY L.580 P.803, JACK OWENS, PS 20709, FOUND SAME OBJECT AND ACCESSORIES AS LCRC P. 40 VASSAR TWP.

SECTION A. CONT. ON BACK OF FORM

FEB 0 8 2001

K-6 T11N-R8E

SECTION

APRIL 1, 1987, SURVEY L.573 P.850, LLOYD MCGINNIS, PS 18999, FOUND SAME OBJECT AND ACCESSORIES AS SURVEY L.2 P.222

JUNE 12, 1989, SURVEY L.608 P.1048, KENNETH DUNTON, PS 23503, FOUND SAME OBJECT AND ACCESSORIES AS LCRC P.40 VASSAR TWP.

APRIL 9, 1991, SURVEY L.628 PP.746-750, JACK OWENS, PS 20709, FOUND RE-ROD, WEST 49.45' FOUND TAG 11192 IN E. FACE P.P., S45°W 59.55' RESET TAG 11192 IN E. FACE 14" ASII, S30°W 76.08' SET TAG 11192 IN E. FACE 20" ASH, N87°E 31.87' SET TAG 11192 IN S. FACE 6" BIRCH

FEB. 20, 1995, SURVEY L.670 PP.876-877, JONATHAN FIELD, PS 37276, FOUND ½" ROD, S30°W 76.05' SET NAIL W/FLAG IN SE FACE 24" ASH, N75°E 35.59' SET NAIL W/FLAG IN NW FACE 6" POPLAR, WEST 49.46' FOUND NAIL W/TAG IN E. FACE P. POLE, EAST 28.60' SET NAIL W/FLAG IN S. FACE 4" ELM, WEST 6.8' CENTER OF N-S ASPH. ROAD

MARCH 27, 1997, SURVEY L.731 P.691, EARL GRAVLIN, PS 23510, FOUND ½" RE-ROD IN MON. BOX, WEST 6.5' NAIL IN C/L PAVEMENT, WEST 49.40' TAG IN POWER POLE, N70°E 35.60' N/SIDE 8" ASPEN, N50°E 39.60' S/SIDE 6" ASH

SEPT. 2, 1997, SURVEY L.736 P.946, JONATHAN FIELD, PS 37276, FOUND SAME OBJECT AND ACCESSORIES AS SURVEY L.628 PP.746-750

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner

FOUND ½" REBAR IN MONUMENT BOX ON EXTENSION OF OCCUPIED LINES TO EAST AND WEST. RECOVERED 5 ACCESSORIES WHICH INDICATE THAT ½" REBAR IS IN SAME POSITION AS SURVEYS AND LCRC'S CITED ABOVE.

ACCEPTED 1/2" REBAR AS BEST AVAILABLE EVIDENCE OF ORIGINAL CORNER POSITION.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

PLACED STANDARD BRASS CAP STAMPED K-6, T11N-R8E, OVER 1/2" BAR. ENCASED CAP AND BAR IN CONCRETE IN EXISTING MONUMENT BOX.

N75°E, 35.51' SET REMON. TAG & NAIL ABOVE FOUND SPIKE IN NW FACE OF 8" POPLAR S45°E, 39.63' SET REMON. TAG & NAIL ABOVE FOUND SPIKE IN SW FACE OF 6" ELM S30°W, 76.00' SET REMON. TAG & NAIL BELOW FOUND SPIKE IN SE FACE OF 24" ASH WEST, 49.52' SET REMON. TAG & NAIL IN NE FACE OF UTILITY POLE N50°W, 79.99' SET REMON. TAG & NAIL IN NE FACE OF UTILITY POLE

Signed by

Date 12/18/00

APPROVED BY TUSCOLA COUNTY REMONUMENTATION PEER GROUP

12/13/2000

Surveyor's Michigan License No. 44289

Fee Wille

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 197: REVISED MAY 14,197:

REVISED JAN., 198



SECTION

K-6 T11N-R8E

