MAY 0.5 1997

1996 REMONUMENTATION PROGRAM

	2	1 %	 676	200	4 4
CO	V	IIV	ات	S. 3	W

LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

For corners in Juniata Township


TUSCOLA	Located In:	Corner Code #
(County)		
1. Public Land Survey	T <u>12N</u> R T R	8E A-6
	T <u>/2///</u> R	7E M-6
2. Property Controlling in Section	S TR S T R	
3. Miscellaneous Property in Sec.	S TR S TR	

Register of Deeds Stamp & File Number

. Lot No,	Recorded Plat
. Private Claims	

Kenneth D. Dunton, in a field survey on Oct. 20, 1995 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

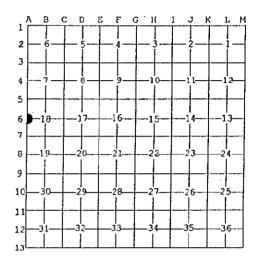

A. Description of original monument and accessories and/or subsequent restoration:

1834 G.L.O. Notes Orange Risdon Set 1/4 Section Post Beech 12 S88W 14L Sugar 12 N13W 21L

Corner M-6, T12N-R7E

June 4, 1990 Survey by Kenneth D. Dunton, L.S. #23503 recorded in Liber 608 Pages 1137 & 1138, Tuscola County Records. Set R.R. spike in pavement by single proportion method. S70°E 39.7' center of 15" elm, S50°W 46.7' center of 15" maple, N50°W 62.3' center of 15" walnut, N01°39'29"E 2635.64' NE corner Sec. 13.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found railroad spike per Survey Liber 608, Page 1137 & 1138. Accepted spike as the proper location of Corner A-6.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Removed railroad spike and placed concrete monument with standard brass cap stamped Corner M-6, T12N-R7E. Placed monument box over monument. Set 11-18-95. S45°52'W 46.61' set T. C. Remon. tag & spike in SE face 18" maple. N53°48'W 61.70' set T. C. Remon. tag & spike in NE face 18" walnut. \$72°04'E 39.40' set T. C. Remon. tag & spike in SW face 24" elm. N37°54'W 111.51' set T. C. Remon. tag & spike in East face p. pole.

N37°55'E 26.45' set 1/2" x 18" re-rod in road shoulder.

This corner is common with M-6, T12N-R7E.

Signed by \_\_\_ 23503

Surveyor's Michigan License No.\_\_\_

Date

FORM APPROVED BY MICHIGAN STATE OF ARE OFFICE SEX

LAND SURVEYOR


STATE OF MICHIGA

SKENNETH D

NOTHUG

\*

JRVEYORS, JAN. 28, 1971 REVISED MAY 14,1975 REVISED JAN, 1933 REVISED OCT., 1995

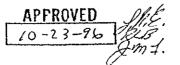



POFESSIONAL

