

1996 REMONUMENTATION PROGRAM
LAND CORNER RECORDATION CERTIFICATE
 Filing Requirement of Act 74, Mich. P.A. 1970

For corners in S. Akron Twp.

<u>Tuscola</u> (County)	Located in:	Corner Code #
1. Public Land Survey	<u>T14NR 8E</u>	<u>F-13</u>
	T ___ R ___	_____
	T ___ R ___	_____
	T ___ R ___	_____
2. Property Controlling in Section	S ___ T ___ R ___	_____
	S ___ T ___ R ___	_____
3. Miscellaneous Property in Sec.	S ___ T ___ R ___	_____
	S ___ T ___ R ___	_____

RECEIVED FOR RECORD
 LIBER NO. _____ PAGE NO. 09
 FILE NO. S. AKRON
 95 DEC 10 PM 4:51
Joseph D. Dunton
 TUSCOLA COUNTY REGISTERED SURVEYORS
 Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

I, Kenneth D. Dunton in a field survey on June 16, 1996 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	10	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

A. Description of original monument and accessories and/or subsequent restoration:

GLQ 1821 Joseph Wampler, D.S. Set 1/2 mile Post Beech 11 S34E 14 Lynn 24 N66W 16	June 12, 1891 G. B. Felton, Co. Surveyor Sec. 33, T14N-R8E, Pages 134 & 135. Set from measure- ments. Elm 6 N 5 1/2 E 44 1/2 Bur Oak 5 N 56 1/2 E 69 1/2 Gas pipe 36" at cor.	Feb. 12, 1963 Consumers Power Co. witness card. Found 5/8" rod 4" below sur- face. S.E. 57.05' 36" Elm. N. 29.28' 34" Elm. N.W. 71.6' Tele. Pole.
--	--	--

Note: Section A continued on back of form.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


Found 3/8" rod & 5/8" rod below. Held rods found as the best evidence of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Removed 3/8" rod & 5/8" rod below. Placed standard monument stamped corner F-13, T14N-R8E. Placed monument box over monument.
 S71°E 157.13' fnd. spke in NW face P. pole.
 S13°W 30.97' center of 2 1/2" pipe post @ gas pipeline marker.
 North 88.86' set remon. tag & spike in W. face 12" Elm.
 S89°38'W 70.27' fnd. railroad spike @ apparent Cor. F-1, T13N-R8E.

Signed by *Kenneth D. Dunton*
 Surveyor's Michigan License No. 23503

Date _____

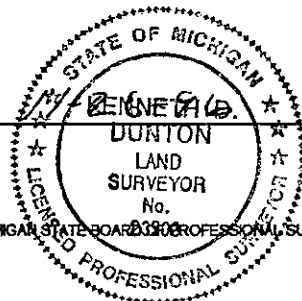

APPROVED
11-25-96
J.P.E.
Q.M.T.
R.S.B.

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
 REVISED MAY 14, 1975
 REVISED JAN., 1983
 REVISED OCT., 1995

MAY 20 1997

29

June 28, 1971
 L.C.R.C. form filed by David T. Rowe, Land Surveyor #11192, Page 1, S. Akron Twp.
 Fnd. 3/8" rod.
 N40°W 71.18' nail in P.P.
 N55°E 110.43' nail in P.P.
 S60°E 157.01' nail in P.P.
 July 8, 1971 Survey by David T. Rowe, Land Surveyor #11192, Liber 561-Page 642.
 3/8" iron rod. Same accessories as L.C.R.C. Page 1.
 Aug. 28, 1973 Survey by David T. Rowe, Land Surveyor #11192, Liber 435-Page 673.
 3/8" rod. Same accessories as L-561, P-642.
 July 25, 1978 Survey by Kenneth D. Dunton, Land Surveyor #23503, Liber 492-Page 1169.
 3/8" rod. Same accessories as L-435, P-673.
 Nov. 7, 1978 Survey by David T. Rowe, Land Surveyor #11192, Liber 492-Page 1168.
 3/8" rod. Same accessories as L-492, P-1169.

