

# LAND CORNER RECORDATION CERTIFICATE

## FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF --:	LOCATED IN --:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY <u>22</u> T. <u>15</u> N. R. <u>8</u> E.		<u>G-8, G-7</u>
2. PROPERTY CONTROLLING IN SECTION _____, T. _____, S., R. _____, E. W.		
3. MISCELLANEOUS PROPERTY IN SECTION _____, T. _____, S., R. _____, E. W.		
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

97

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Thomas G. Moran, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on October, 1979, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_, 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

- A. Description of original monument and accessories and/or subsequent restoration:
- G-8 Unable to find any written record of this corner being used or re-established since original survey.
  - G-7 Unable to find any written record of this corner being used or re-established since original survey.

- B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:
- G-8 Dug 10'x 12'x 4' hole in vicinity of corner and found nothing. Set 4"x 36" concrete monument with aluminum cap mid-way and on line between section corners.
  - G-7 Found 3/4" iron pipe with metal locator. Set 4"x 36" concrete monument with aluminum cap.

- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
- |   |   |
|---|---|
| G-8 4"x 36" Concrete Monument<br>N 88° E 63.71' Power Pole<br>S 67° E 49.20' 4" W. Ash<br>N 65° E 91.8' N.W. Cor. Bldg.<br>N 82° W 105.36' Power Pole | G-7 4"x 36" Concrete Monument<br>S 85° E 25.06' Guardrail Post<br>East 7.0' ∩ Gravel Road<br>North 250' S. end of Br.<br>South 25' ∩ Ditch going west |
|---|---|


SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_ (SEAL)

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

APPROVED AND SIGNED BY Thomas G. Moran DATE 1-15-80  
CHIEF OF SURVEY PARTY MICHIGAN REGISTERED LAND SURVEYOR

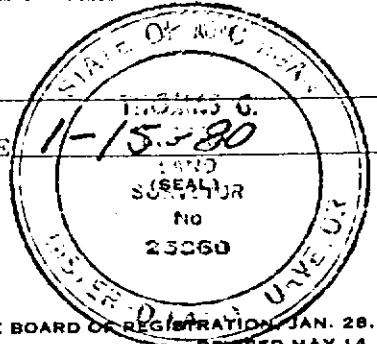

SURVEYOR'S MICHIGAN REGISTRATION NO. 25860