

FEB 28 1993

COMMISSION

RC 1224

L127004PA580

LAND CORNER RECORDATION CERTIFICATE
Filing requirement of Act 74, Mich. P.A. 1970

For corners in WAYNE COUNTY (County) Located In: Corner Code #
1. Public Land Survey T 1 S R 9 E G-2
2. Property Controlling in Section S T R
3. Miscellaneous Property in Sec. S T R
4. Lot No. Recorded Plat
5. Private Claims

Compliance with ACT 345, P.A. 1990
APPROVED ON: 12/3/93 YCW
WAYNE COUNTY REMONUMENTATION PEER GROUP COMMITTEE
Register of Deeds Stamp & File Number

I, ROBERT J. SMALLEY, in a field survey on NOVEMBER 22, 1993, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the cornerpoints mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

Grid table with columns A-L and rows 1-13. A dot is present in cell (2,4). A vertical stamp 'TOWN' is on the right side.

A. Description of original monument and accessories and/or subsequent restoration:

- GLO (1816): "POST"
WPA (1930's): "IRON W-3"
LCRC (1978): "FOUND MONUMENT IN HANDHOLE" (RC-596; L. 20174, P. 850)
LCRC (1981): "FOUND IRON IN MONUMENT BOX" (RC-748; L. 21061, P. 911)

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

FOUND CONCRETE MONUMENT (WITH 1/2" BAR) IN MONUMENT BOX; CHECKED WITNESSES RECORDED IN RC-596 AS FOLLOWS:

- N.W., 66.44'; SE BOLT, BASE OF LIGHT POLE. (MEAS. N 30° W, 66.43')
N.E., 91.87'; NAIL, S. SIDE DE POLE (MEAS. S 35° E, 91.91')
S.E., 58.05'; NW BOLT, BASE OF LIGHT POLE (MEAS. S 44° E, 57.89')


C. Description of monument for corner and accessories to perpetuate locating the position of the corner:

FOUND CONCRETE MONUMENT (WITH 1/2" IRON BAR) IN MONUMENT BOX IN FARMINGTON ROAD; SET "WAYNE COUNTY REMONUMENTATION" TAG AND SURVEY CAP "30086-26467" OVER BAR OF MONUMENT.

- N. 30° W. 66.43'; CENTERLINE OF SOUTHEAST BOLT OF LIGHT POLE BASE.
N. 35° E. 91.91'; SET NAIL WITH "WCR WITNESS" TAG IN SOUTH FACE OF UTILITY POLE.
S. 44° E. 57.89'; CENTERLINE OF NORTHWEST BOLT OF LIGHT POLE BASE.
S. 15° W. 128.51'; CENTERLINE OF NORTHEAST BOLT ON LIGHT POLE BASE.

THE SELECTED LOCATION IS ACCEPTED BY THE CONTRACTOR AND IS GENERALLY ACCEPTED BY PROFESSIONAL SURVEYORS AS THE BEST AVAILABLE EVIDENCE OF THE ORIGINAL CORNER.

Signed by Robert J. Smalley Date Nov 30, 1993
Surveyor's Michigan License No. 26467

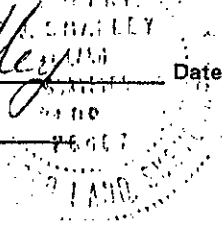

Vertical stamps: 'DEC-3 PM12:11' and handwritten '2R 11D M'.