APR 2 5 1995

LAND CORNER RECORDATION CERTIFICATE MISCELLANEOUS RECORDING Filing requirement of Act 74, Mich. P.A. 1970 94 3:41 P.M.

Private Claims

COMMISSION

RECEIPT# 93A RECORDED

For corners in **WAYNE COUNTY** Located In: (County)

FOREST E. YOUNGBLOOD, REGISTER OF DEEDS MAYNE COUNTY, HT

> Compliance with ACT 345, P.A. 1990.

APPROVED ON: 12-12-99 WAYNE COUNTY REMONUMENTATION PEER GROUP COMMITTEE


Register of Deeds Stamp & File Number

Corner Code # Public Land Survey 80 - M R Т Property Controlling S R in Section S Miscellaneous S Property in Sec. S

, Recorded Plat

\_, in a field survey on <u>SEPTEMBER 2</u> i, ROBERT J. SMALLEY . 19 94 do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the cornerpoints mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

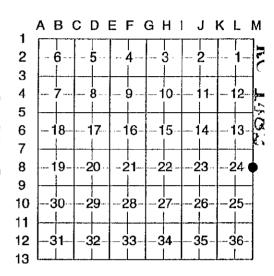

A. Description of original monument and accessories and/or subsequent restoration:

GLO (1816): "POST"

WPA(1930'S): "FOUND STAKE - 1-1/2" SQUARE - TOP BROKEN OFF 4"-5" BELOW GROUND REPLACED WITH 4'-0" CONCRETE MONUMENT - TOP OF MON 6" BELOW SURFACE,"

Description of corner evidence found and/or method applied in restoring or reestablishing corner:

FOUND CONCRETE MONUMENT ( WITH 1/2" PIPE ) IN MONUMENT BOX IN THE CENTER OF INKSTER ROAD. CHECKED CORNER WITNESSES TO M-8 (AND A-8 OF REDFORD) AGAINST WPA SURVEY DISTANCES AND AGAINST FOUND POINTS IN SUPERVISOR'S REDFORD PLAT NO. 3 (L. 69, P. 54) AS **FOLLOWS:** 

M-8 to A-8 -44.2" (MEAS. 44.76') M-8 to SW CORNER OF LOT 129 OF SUPERVISOR'S REDFORD PLAT No. 3 -62.94 (MEAS, 62.64') PERPENDICULAR DISTANCE FROM M-8 TO WEST LINE OF PLAT (MEAS. 60.00') 60.001

C. Description of monument for corner and accessories to perpetuate locating the position of the corner:

FOUND CONCRETE MONUMENT (WITH 1/2" PIPE) IN MONUMENT BOX IN THE CENTER LINE OF INKSTER ROAD (ASPHALT PAVEMENT) SOUTH OF LYNDON ROAD TO THE EAST AND NORTH OF LYNDON ROAD TO THE WEST; SET "WAYNE COUNTY REMONUMENTATION" TAG AND SURVEY CAP No. "30086-26467" OVER PIPE IN MONUMENT.

FOUND CONCRETE MONUMENT (WITH 1/2" PIPE) IN MONUMENT BOX AT CORNER **NORTH** 44.76'; A-8 (REDFORD).

FOUND CONCRETE MONUMENT AT ANGLE POINT IN WEST LINE OF LOT 129 OF N. 54° E. 74.75';

SUPERVISOR'S REDFORD PLAT No. 3. ZRFOUND CONCRETE MONUMENT AT THE SW CORNER OF SAID LOT 129. S. 73° E. 62.64';

HDSET NAIL WITH "WCR WITNESS" TAG IN NORTH SIDE OF UTILITY POLE. WEST 59.95'; SET NAIL WITH "WCR WITNESS" TAG IN NORTH SIDE OF 12" PINE TREE. 70.18'; MISC

THE SELECTED LOCATION IS ACCEPTED BY THE CONTRACTOR AND IS **GENERALLY ACCEPTED BY PROFESSIONAL SURVEYORS AS THE BEST** 

AVAILABLE EVIDENCE OF THE ORIGINAL CORNER.

ROBERT J. SMALLEY

Surveyor's Michigan License No. 26467

