

**SURVEY & REMONUMENTATION**

**RC 1562**

APR 25 1995

**LAND CORNER RECORDATION CERTIFICATE**  
Filing Requirement of Act 74, Mich. P.A. 1970

**L127800PA053**

**COMMISSION**

corners in

Wayne <small>(County)</small>	Located In:	Corner Code #
Public Land Survey	T 1 S R 10 E	M-5
	T ___ R ___	_____
	T ___ R ___	_____
	T ___ R ___	_____
Property Controlling in Section	S ___ T ___ R ___	_____
Miscellaneous	S ___ T ___ R ___	_____
Property in Sec.	S ___ T ___ R ___	_____

Compliance with ACT 345, P.A. 1990  
APPROVED ON: 12-8-94 *W.P.J.*  
WAYNE COUNTY REMONUMENTATION PEER GROUP COMMITTEE

**RC 1562**

Register of Deeds Stamp & File Number

Lot No. \_\_\_\_\_ Recorded Plat \_\_\_\_\_  
Private Claims \_\_\_\_\_

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2								
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

William L. Roskelly in a field survey on November 1, 1994, hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.**

**A. Description of original monument and accessories and/or subsequent restoration:**

M-5) SOUTHEAST CORNER SECTION 12, T.1 S., R.10 E.  
G.L.O. (1830's) Joseph Fletcher set corner post witnesses: Maple 16 N. 68 W. 12, W.06 S. 2 30W.23.  
W.P.A. (1930's) no witnesses found.  
Fall and Basney survey, 10/8/53 found concrete monument, no witnesses in field notes.  
No R.C.'s or C.S.'s found on file at Wayne County Reg. of Deeds. \$ 13.00 MISCELLANEOUS RECORDING

28 DEC 94 8:20 A.M. RECEIPT# 12D  
RECORDED  
FOREST E. YOUNGBLOOD, REGISTER OF DEEDS  
WAYNE COUNTY, MI


**B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:**

M-5) SOUTHEAST CORNER SECTION 12, T.1 S., R.10 E.  
Found an iron pipe in a concrete monument in a mon. box at the intersection of 6 Mile and Greenfield Roads. Verified corner location by comparing City of Detroit data with field measurements:  
M-5 to M-4 Record = 2620.47 Measured = 2621.02  
M-5 to L-5 Record = 2628.99 Measured = 2629.34  
M-5 to M-6 Record = 2628.95 Measured = 2629.32  
M-5 to B-5 (T.1 S.R.11 E.) Measured = 2640.24  
Angle line M-5 & M-4 to line M-5 & L-5 Record = 89° 57' 20" Measured = 89° 57' 21"  
Angle line M-5 & L-5 to line M-5 & M-6 Record = 90° 11' 50" Measured = 90° 11' 36"  
Angle line M-5 & M-6 to line M-3 & B-5 (T.1 S.R.11 E.) Measured = 92° 14' 42"  
Angle line M-3 & B-5 (T.1 S.R.11 E.) to line M-5 & M-4 Measured = 87° 36' 21"

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

M-5) SOUTHEAST CORNER SECTION 12, T.1 S., R.10 E.  
Found an iron pipe in a concrete monument in a mon. box at the intersection of 6 Mile and Greenfield Roads. The selected location is accepted by the Contractor and is generally accepted by professional surveyors as the best available evidence of the position of the original corner. WITNESSES:  
Set nail & W.C.R. tag N.W. face P. pole N. 40° E. Dist. = 75.41  
Set nail & W.C.R. tag S.W. face P. pole S. 43° E. Dist. = 68.17  
Set nail & W.C.R. tag N.W. face P. pole S. 43° W. Dist. = 63.37  
Set nail & W.C.R. tag N.E. face P. pole N. 45° W. Dist. = 76.07  
Placed Wayne County Remonumentation brass marker and cap #10705

*2R  
11 D  
MISC*

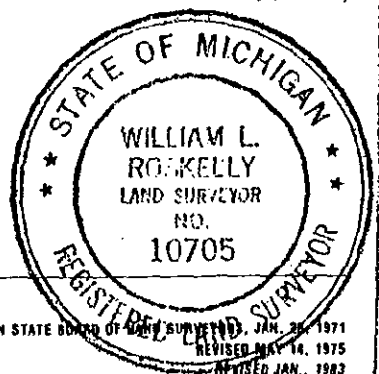

Signed by William L. Roskelly Date 12/27/94  
Surveyor's Michigan License No. 10705