

FILE DO NOT MAIL

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
SECTION
WAYNE
(County)

Located In:
DETROIT

Corner Code #

Liber-29744 Page-1031.0
97335337LS 12/22/1997 10:13AM

1. Public Land Survey

T	S	R	12E	K-1
T		R		
T		R		
T		R		

2. Property Controlling in Section

S	T	R		
S	T	R		

3. Miscellaneous Property in Sec.

S	T	R		
S	T	R		

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, **MARTIN C. DUNN**, in a field survey on **NOVEMBER 24, 1997**, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

UNDER CONTRACT FOR THE GLO ORIGINAL SURVEY SEPTEMBER 1816 JOSEPH FLETCHER SET A POST
NO EVIDENCE OF ORIGINAL CORNER

PLATS

L. 8 P. 88 (M.C.R.)	"RICE & MILLER'S SUBD'N"	3-18-1925
L. 54 P. 98	"SCHOENHERR MANOR SUB'N"	6-2-1925
L. 55 P. 8	"HUNDS REGENT PARK"	6-5-1925

\$7.00 DEED
RECORDED
FOREST E. YOUNGBLOD, REGISTER OF DEEDS
WAYNE COUNTY, MI
Receipt #43579
\$4.00 REMONUMENTATION


	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

FOUND IRON BAR IN EXISTING MON. BOX
VERIFIED LOCATION USING TIES TO ADJACENT SECTION CORNERS AND FOUND PROPERTY CORNERS
ALONG 8 MILE ROAD

FIELD MEASUREMENTS AND RECORD DISTANCES

K-1 TO L-1	2643.17 (M)	2643.03 (PLATS)	40 CH. (GLO)	89°33'33" AZ.
K-1 TO K-2	2637.27 (M)	2637.32 (PLATS)	40 CH. (GLO)	180°00'00" AZ.
K-1 TO J-1	2642.49 (M)		40 CH. (GLO)	269°39'23" AZ.
K-1 TO K-12 (T.1N., R.12E.)	2621.02 (M)		40 CH. (GLO)	359°58'17" AZ.

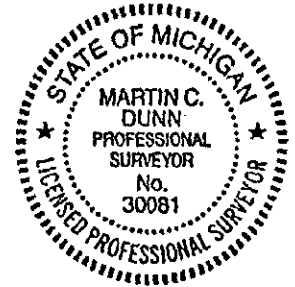

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
K-1, NORTHWEST CORNER SECTION 1, (COMMON CORNER) T.1S., R.12E., WAYNE COUNTY

REPLACED IRON BAR WITH 1/2"x18" REROD WITH ALUMINUM WAYNE COUNTY REMONUMENTATION CAP W/ #30081
IN EXISTING MONUMENT BOX.

WITNESSES

EAST	34.44'	SET NAIL W/ WAYNE COUNTY REMON. TAG IN NORTH FACE UTILITY POLE.
130° AZ.	45.25'	SET NAIL W/ WAYNE COUNTY REMON. TAG IN CONC. CURB AT JOINT LINE.
WEST	53.25'	TOP NORTH STEEL FOUNDATION BOLT ELECTERIC TRANSMISSION TOWER.
322° AZ.	44.83'	SET NAIL W/ WAYNE COUNTY REMON. TAG IN CONC. CURB AT JOINT LINE.

THE SELECTED LOCATION IS A CAREFUL AND FAITHFUL PERPETUATION OF THE POSITION OF THE ORIGINAL CORNER.

Signed by Martin C. Dunn
Surveyor's Michigan License No. 30081

Date 12/5/97