RC 1142

DEC 0 2 1993

CON	AN	/	3 3	ION
-----	----	---	------------	-----

expressed below:

C-3/C-2:

LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

FO	Comers in						
	WAYNE		Located In:		Corner Code ##		
	(County)						
1.	Public Land Survey		T 28 R	9E	C-3		
•			T R .				ľ
			'TR_				
			TR_	_}	LE OF WICH	<u> </u>	^
2.	Property Controlling	s	_ T R _	3 %	OF MICH		W/
	in Section	s	_ T R ,		PETER P. N		!
3.	Miscellaneous	s	_ T R		PALCZYNSKI	*	Regi
	Property in Sec.	s	_ T R		PROFESSIONAL	٦	
			3	61	SURVEYOR	19	
4.	Lot No	, Recorded F	Plat	21	No. 30096	iu g	_
5.	Private Claims			*	30096	8	
			•	1	A)	*	
				7	VFE881010	F	
					A CONTRACTOR OF THE PARTY OF TH		
	D D Dalagungki			Q	November		Q 3

Compliance with ACT 345, P.A. 1990


PPROVED ON: _*|||24/93* AYNE COUNTY REMONUMENTATION PEER GROUP COMMITTEE

ster of Deeds Stamp & File Number

, in a field survey on. do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

Description of original monument and accessories and/or subsequent restoration:

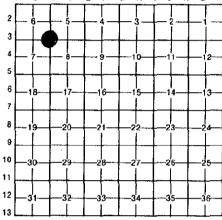

NANKIN TOWNSHIP

G.L.O.- (1830'S) DESCRIPTION OF CORNER MONUMENT NOT STATED IN FIELD NOTES. WITNESSES LISTED: POPLAR 9 EAST 50 (33.3') (GONE) & DO." 9 S 12.41(8.19')(GONE) 49.13'(GONE) W.P.A.-(1930'S) IRON OVER STONE. WITNESSES SHOWN: ED. POLE NE 12" ELM SW 33.11'(GONE) C.S.#541,L.18421,P.24;C.S.#552,L.18421,P.40; 6" 23.0' (GONE) MAPLE C.S.#554,L.18421,P.44(5-10-73)ALL. 12" POPLAR 52.7' (GONE) NW R.C.#706,L.20737,P.753.

MEAS. = 2615.05'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

FOUND 1/2" REROD. IN MONUMENT BOX AT NEWBURGH ROAD.

MEASURED DISTANCES FOR COMPARISON TO W.P.A. RECORDS:

W.P.A. = 2614.56L.C.R.C.#706 L.20737, P. 753, (12-10-79).

> NAIL IN UTILITY POLE. N30°E 55.30' (MEAS. 55.30') 43.65' (MEAS. 43.55'-HIT) PIPELINE MARKER. S75°E N.E. COR. HOUSE #7193 S75°W 166.65' (MEAS.166.65') IRON BAR. WEST 60.00' (GONE)

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner: C-3: SECTION CORNER 5,6,7 & 8, T2S R9E, FOUND 1/2" REROD IN MONUMENT BOX. THE SELECTED LOCATION IS ACCEPTED BY THE CONTRACTOR AND IS GENERALLY ACCEPTED BY PROFESSIONAL SURVEYORS AS THE BEST AVAILABLE EVIDENCE OF THE POSITION OF THE ORIGINAL CORNER. PLACED W.C.REMON. BRASS MARKER AND CAP "PPP PS 30096".

SET NAIL/WCR TAG IN N.W. FACE UTILITY POLE.		N25°E	55.33'
SET NAIL/WCR TAG IN NORTH FACE UTILITY POLE.		EAST	32.13'
SET CUT "X" IN NORTH RIM OF STORM MANHOLE.		\$35°E	53.55'
SET CUT "X" IN N.E. RIM OF CATCH BASIN.		s 35°W	37.68'
NORTHEAST CORNER OF HOUSE #7193.		\$75°W	166.65'
SET NAIL/WCR TAG, IN N.E. FACE UTILITY POLE.		N40°W	71.05'
Signed by	Date	15 NOVEM	BER 1993

Surveyor's Michigan License No. ___

30096

FORM APPROVED BY MICHIGAN STATE ROARD OF LAND SURVEYORS, JAN. 28, 1971

REVISED MAY 14, 1975 BEVISED JAN., 1983