RECORDED

EDS

City of Dearborn Heights

3. Miscellaneous Property in Sec. LAND CORNER RECORDATION CERTIFICATE. YOUNGOLOOD, REGISTER Filing Requirement of Act 74, Mich. P.A. 1970

** *			
	MAAHE	COUNTY	HΙ

For corners in			1
Wayne (County)	Located In:	Corner Code #	
1. Public Land Survey	T <u>2\$</u> R <u>10E</u> T R T R	D-13	
Property Controlling in Section	TR_ S TR_ S T_R_		

LIBER 29357 PAGE

Compliance with ACT 345, P.A. 1990


APPROVED ON: DEC 17, 1996 WAYNE COUNTY REMONUMENTATION PEER GROUP COMMITTEE

Register of Deeds Stamp & File Number

	X.	` ,	`` <u>`</u>
4. Lot No,	Recorded Plat		
5. Private Claims			· · · ·

, in a field survey on OCTOBER 23, 19 96 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

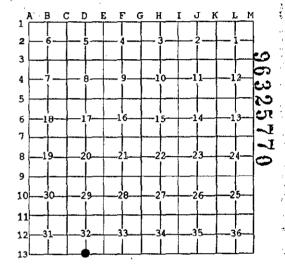

A. Description of original monument and accessories and/or subsequent restoration:

D-13) South1/4 Corner of Sections 32, T 2 S, R 10 E **GENERAL LAND OFFICE** SET POST FOR CORNER POPLAR-12"-N31°W-8 LINKS(5.28") ELM 9"-N72°E-45 LINKS(29.70')

DECEMBER 16, 1816

BY: JOSEPH FLETCHER, DS

WAYNE COUNTY BUREAU OF TAXATION IRON

NE'LY-91.49'-EDISON POLE GONG

SE'LY-34.90'15" MAPLE & WEST-44.50'-N. 1/4 COR. SEC. 5, T3S, R10E

NW'LY-101.38'-EDISON POLE GONE

LCRC BY RICHARD W. SWANSON, PS #9748 DATED MARCH 15, 1976 RECORDED LI. 19356, PG. 67 WAYNE COUNTY ROAD COMMISSION CONCRETE MONUMENT IN BOX

WNW-132.92'-SPIKE & TAG IN NE SIDE OF EDISON POLE FOUND NW-79.25'-'X" CUT IN WALK ON NORTH PARALLEL TO VAN BORN &... NE-76.25'-X' CUT IN WALK ON NORTH PARALLEL TO VAN BORN GOOD NE-67.62'-SPIKE & TAG SE SIDE EDISON POLE FOUND

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

D-13) South 1/4 Corner of Section 32, T 2 S, R 10 E

Found concrete monument with 1/2" pipe in monument box. Distance to E-13 measured 2645.48' (WPA=2645.36'). Distance to C-13 measured 2626.27' (WPA=2626.25').



NOT A COMMON CORNER.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

D-13) South 1/4 Corner of Section 32, T 2 S, R 10 E

Found concrete monument with 1/2" pipe in monument box. Set spike inside pipe and placed Wayne County brass disk stamped with license #21566 on pipe. Road surface is concrete. Corner is accepted as a careful and faithful reestablishment of the position of the original corner.

Witnesses:

67,35' - Found nail and WCRC tag on SE side of utility pole (recorded as 67.62')

N68°W - 132.84' - Found nail and WCRC tag on SW side of utility pole (recorded as 132.92')

S48°W - 128.98.' - NE corner of house foundation (#25001)

S80°E - 254.50' - Top center of fire hydrant

44.52' - Found 1/2" pipe in concrete monument in monument box at north 1/4 corner of

Section 5, T 3 S, R 10 E

Farmens R. Surveyor's Michigan License No. 21566

December 6, 1996 Date