

FILE DO NOT MAIL

LAND CORNER RECORDATION CERTIFICATE
 Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

WAYNE (County)	Located In: CITY OF ROMULUS	Corner Code #
1. Public Land Survey	T 3 S R 9 E	C-6
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
4. Lot No. _____, Recorded Plat _____		
5. Private Claims _____		

Compliance with
 ACT 345, P.A. 1990
 APPROVED ON: 12-7-99
 WAYNE COUNTY REMONUMENTATION
 PEER GROUP COMMITTEE
 Register of Deeds Stamp & File Number

I, CHRISTOPHER S. LAMUS, in a field survey on MARCH 2, 19 99, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate

A. Description of original monument and accessories and/or subsequent restoration:

ORIG. GOVERNMENT NOTES 1817
 WITNESSED BY FLETCHER - SET POST
 N 57° W 14 LINKS 10' POPLAR (1)
 N 1° W 1.27 CHAINS 12' B.D. (2)

NO G.L.D. WITNESSES REMAIN

B. Description of corner evidence and/or method applied in restoring or reestablishing corner:

WAYNE CO. BUREAU OF TAXATION (1930'S)
 MONUMENT (NO DESCRIPTION)
 N.W. 42.28' 20° ELM (3) GONE
 WLY. 33.32' IRON (4) FOUND
 S.E. 76.97' 18° ELM (5) GONE
 S.E. 66.14' 20° ELM (6) GONE
 N.E. 25.74' 30° ELM (7) GONE

PUBLIC ACT 74 L.C.R.C. L.22105 P.596 (1984)
 (C-6) FOUND 3/4" PIPE IN MON. BOX
 APPROX. 20' NORTH OF McBRIDE RD.
 S 15° E 57.88' T.P. (8) FOUND
 S 50° W 69.81' TOP CTN. F. HYD. (9) FOUND
 N 65° W 45.27' FACIA GAS VENT PIPE (10) GONE
 S 65° W 30.68' NW COR. CONC. HDWL. (11) GONE

PUBLIC ACT 74 L.C.R.C. L.18213 P.958 (1972)
 (C-6) FOUND 1/2" IRON PIPE APPROX. 20' NORTH OF
 McBRIDE ROAD (EAST) AND IN OZGA ROAD N & S
 N 15° E 79.46' T. POLE (12) GONE
 N 45° E 18.24' NE COR. HDWL. (13) GONE
 S 14° E 64.22' T. POLE (14) GONE
 S 50° W 69.81' TOP OF F. HYD. (9) FOUND
 N 65° W 45.27' FACIA OF GAS VENT PIPE (10) GONE


PUBLIC ACT 74 L.C.R.C. L.18285 P.573 (1972)
 (C-6) FOUND IRON PIPE
 N 15° E 79.43' UTILITY POLE (12) GONE
 N 20° W 45.26' 3" GAS MARKER (15) GONE
 S 50° W 69.81' HYDRANT (TOP NUT) (9) FOUND
 S 14° E 64.22' UTILITY POLE (14) GONE

DISTANCE TO C-5 2632.92' (M) RECORDED AS 2632.83' BY WAYNE COUNTY BUREAU OF TAXATION.
 DISTANCE TO D-6 2680.62' (M) COMPUTED AS 2681.55' PER WAYNE COUNTY BUREAU OF TAXATION.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

C-6
 3/4" IRON PIPE IN MON. BOX
 SET BRASS W.C. WASHER AND SURVEYOR'S CAP #41914 OVER 3/4" IRON PIPE IN MON BOX.
 CORNER IS LOCATED IN PAVEMENT OF OZGA ROAD APPROX. 20' NORTH OF McBRIDE ROAD.

N 14° E 77.18' SET W.C. RE-MON BRASS WASHER IN W. SIDE UTILITY POLE. (16)
 N 46° E 46.07' FOUND P&C #27446. (17)
 S 47° E 73.68' SET W.C. RE-MON BRASS WASHER IN N. SIDE 14" PINE. (18)
 S 21° E 57.89' SET W.C. RE-MON BRASS WASHER IN E. SIDE UTILITY POLE. (8)
 S 45° W 69.81' CENTERLINE TOP-NUT ON F. HYD. (9)
 WEST 33.32' FOUND 3/8" IRON ROD IN CONC. (4)

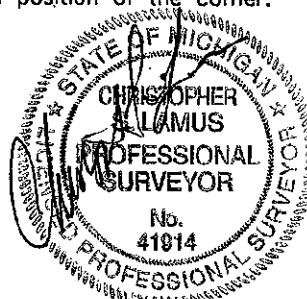

THE SELECTED LOCATION IS ACCEPTED BY THE CONTRACTOR AND IS GENERALLY ACCEPTED BY PROFESSIONAL SURVEYORS AS THE BEST AVAILABLE EVIDENCE OF THE POSITION OF THE ORIGINAL CORNER.

Signed by Christopher S. Lamus
 Surveyor's Michigan License No. 41914

Date 12/23/99

R LCR 9 4R 1Pg A JBJ