

**APR 05 1996 LAND CORNER RECORDATION CERTIFICATE**  
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in **COMMISSION**

<u>WAYNE</u> (County)	Located in: Huron Township	Corner Code # <u>G-13</u>
--------------------------	-------------------------------	------------------------------

- Public Land Survey  
T 4S R 9E  
T \_\_\_\_\_ R \_\_\_\_\_  
T \_\_\_\_\_ R \_\_\_\_\_  
T \_\_\_\_\_ R \_\_\_\_\_
- Property Controlling in Section  
S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_  
S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_
- Miscellaneous Property in Sec.  
S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_  
S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_
- Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_
- Private Claims \_\_\_\_\_

**LIBER 28451 PAGE 495**

Compliance with  
ACT 345, P.A. 1990

APPROVED ON: 11-28-95 *DJ*  
WAYNE COUNTY REMONUMENTATION  
PEER GROUP COMMITTEE

Register of Deeds Stamp & File Number

I, Randy Kolehouse, in a field survey on July 28 19 94, do hereby certify that under requirements of P.A. 74 Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.**

**A. Description of original monument and accessories and/or subsequent restoration:**

G-13 1817	G.L.O. Notes	N/A	Post	\$ 4.00 REMONUMENTATION
1930's	WPA Notes	N/A	Iron	\$ 7.00 DEED
1974	WCRC Notes	N/A	Iron in Broken Box	DEC 95 12:36 P.M. RECEIP
1980	Cert. Survey L. 20876 P. 662-664	Arthurs	Monument	RECORDED

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	10	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

45262450  
EDS

**B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:**

G-13 Found concrete monument in broken monument box 10" ± below surface. Also found R.R. spike at the C/L intersection of Will Carleton Road (asphalt) running E-W and Romine Road (gravel) running North which agrees with the following witnesses.

Cert. Survey L. 20876 P. 662-664 Hyd. NW'ly 84.24' (84.12' m) WCRC Tag NW Face Util. Pole SW'ly 48.78' (48.84' m)	WCRC Nail w/Tag NE Face D.E. Pole SE'ly 63.42' (66.28' m) Nail w/Tag NW Face D.E. Pole SW'ly 48.77' (48.84' m)
----------------------------------------------------------------------------------------------------------------------------	----------------------------------------------------------------------------------------------------------------------


Measures East to H-13 = 2629.95' (G.L.O. = 2640') (WPA = 2631.97')  
Measures West to F-13 = 2636.19' (G.L.O. = 2640') (WPA = 2636.25') (CS = 2635.86')

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

G-13 Replace R.R. spike with 1/2" rebar with aluminum cap stamped "Wayne Co. Remon." in new monument box

- Nail w/Tag "WCRC" N Face Util. Pole N 66° E 64.62'  
P.K. C/L Road S 83° E 58.35'
- Nail w/Tag "WCRC" N Face Util. Pole S 58° E 66.28'
- Nail w/Tag "WCRC" NW Face Util. Pole S 61° W 48.84'
- C/L Top Nut Hyd. N 13° W 84.12'

**NOT A COMMON CORNER**

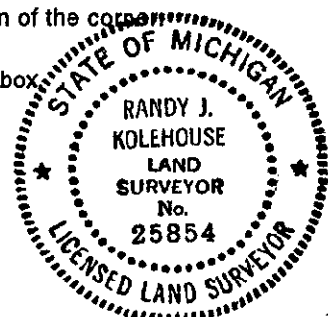

The selected location is accepted by the Contractor and is generally accepted by professional surveyors as the best available evidence of the position of the original corner.

Signed by Randy J. Kolehouse Date 12/2/95  
Surveyor's Michigan License No. 25854

42  
70  
DJ