

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

\$ 4.00 REMONUMENTATION

\$ 10.00 DEED

26 DEC 96 12:43 P.M.

RECEI

R

RECORDED

FOREST E. YOUNGBLOOD, REGISTER
 WAYNE COUNTY, MI

EDS

LI 29360 PA 577

Compliance with
 ACT 345, P.A. 1990

DBJ

APPROVED ON: DEC. 17, 1996

WAYNE COUNTY REMONUMENTATION
 PEER GROUP COMMITTEE
 Register of Deeds Stamp & File Number

96326793

For corners in

WAYNE

(County)

Located in: Huron
 Township

Corner Code #

- | | | |
|---------------------------------------|--|------------|
| 1. Public Land Survey | T <u>4S</u> R <u>9E</u> | M-8 |
| | T <u>4S</u> R <u>10E</u> | COMMON TO |
| | T <u>4S</u> R <u>10E</u> | <u>A-8</u> |
| 2. Property Controlling in Section | S <u> </u> T <u> </u> R <u> </u> | |
| 3. Miscellaneous Property in Sec. | S <u> </u> T <u> </u> R <u> </u> | |
| 4. Lot No. _____, Recorded Plat _____ | | |
| 5. Private Claims _____ | | |

I, Randy Kolehouse, in a field survey on December 5 19 96, do hereby certify that under requirements of P.A. 74 Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

M-8	1817	G.L.O.	Fletcher	Notes	Post
	1930's	WPA Notes	N/A	Section Map and Ties	Iron
	1973	W.C.R.C.	Coon	Witness Record	Iron

Records indicate this corner is common with A-8 T4S R10E.

(Continued on Back)

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

M-8 Found a 1/2" pipe in a concrete monument box in the C/L intersection of Inkster Road (asphalt) running North and South and Grix Road (gravel) running West per the following witnesses:

W.C.R.C. Witness Record (1973)
 Nail & Tag NW Side D.E. Pole NE 114.77' (m. 114.78')
 C.L Top Hydrant NE 77.52' (m. 77.38')
 Nail & Tag NE Side D.E. Pole SE 42.75 (m. 42.68')
 C/L Top Hydrant SW 97.20' (m. 97.18')

Cert. Survey L. 20356 P. 817-818 (1978) - A-10 T4S R10E
 C/L Hydrant N 30° E 77.38' (m. 77.38')
 Nail & W.C.R.C. Tag D.E. Pole S 50° E 42.70' (m. 42.68')
 C/L Hydrant S 70° W 97.15' (m. 97.18')

L.C.R.C. L. 19690 P. 782 (1977)
 Top Nut Hydrant N 30° E 77.38' (m. 77.38')
 W.C.R.C. Cap N Side D.E. Pole S 50° E 42.70' (m. 42.68')
 Top Nut Hydrant S 70° W 97.15' (m. 97.18')

Cert. Survey L. 20927 P. 169 (1980) - M-8 T4S R9E
 W.C.R.C. Nail & Tag NW Side Util. Pole NNE 114.70' (m. 114.78')
 C/L Hydrant NE 77.47' (m. 77.38')
 Nail & Tag NE Side Util. Pole SE 42.69' (m. 42.68')
 C/L Hydrant SW 97.18' (m. 97.18')

Measure North to M-7 = 2639.18' (WPA = 2639.06) (G.L.O. = 2640.0') (Survey L. 20356 P. 818 = 2638.85')
 Measure South to M-9 = 2656.01' (WPA = 2656.29) (G.L.O. = 2640.0')

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

M-8 Set brass "Wayne Co. Remon." disk and survey cap #25854 on the existing concrete monument in an existing monument box.


- Nail w/W.C.R.C. Tag in W Side P. Pole N 21° E 114.78'
- Top Nut Hydrant N 40° E 77.38'
- Nail w/W.C.R.C. Tag in NE Side P. Pole S 41° E 43.31'
- Top Nut Hydrant S 78° W 97.18'
- P.K. Nail in N Side Tele. Pole S 80° W 89.12'

The selected location is accepted by the Contractor and is generally accepted by professional surveyors as the best available evidence of the position of the original corner.

Signed by Randy J. Kolehouse

Date 12/24/96

Surveyor's Michigan License No. 25854

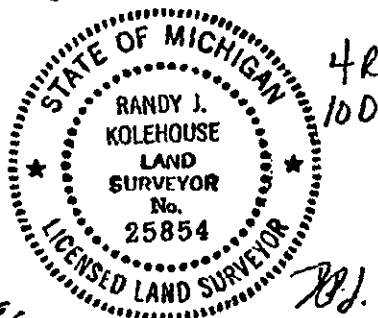

Part A (Continued)

LI29360PA578

1975	Cert. Survey	Ayers #4615	L. 19269 P. 514-515	Concrete Monument
1976	Cert. Survey	Stanley #12031	L. 19855 P. 735-736	Concrete Monument in Box
1977	L.C.R.C.	Wilkerson #21584	L. 19690 P. 782	Monument in Handhole
1977	Cert. Survey	Ayers #4615	L. 19962 P. 362-364	Concrete Monument in Box
1978	Cert. Survey	Arthurs #11358	L. 20098 P. 246-247	W.C.R.C. Concrete Monument
1978	Cert. Survey	Arthurs #11358	L. 20184 P. 876-877	W.C.R.C. Monument
1978	L.C.R.C.	Arthurs #11358	L. 20098 P. 248	W.C.R.C. Monument
1978	Cert. Survey	Crossman #9428	L. 20356 P. 817-818	Monument in Handhole
1980	Cert. Survey	Arthurs #11358	L. 20927 P. 169-171	Concrete Monument in Handhole