

FILE DO NOT MAIL

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

WAYNE
(County)

Located in: BrownsTown Township

Corner Code #

ROCK Both

1. Public Land Survey

T 5S R 10E

B-1

2. Property Controlling in Section

S T R

SURVEY & REMONUMENTATION

3. Miscellaneous Property in Sec.


S T R

MAR 17 1998

Compliance with ACT 345, P.A. 1990
APPROVED ON: 12-1-97
WAYNE COUNTY REMONUMENTATION PEER GROUP COMMITTEE
Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____ SECTION _____
5. Private Claims _____

I, Randy Kolehouse, in a field survey on November 21 19 97, do hereby certify that under requirements of P.A. 74 Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

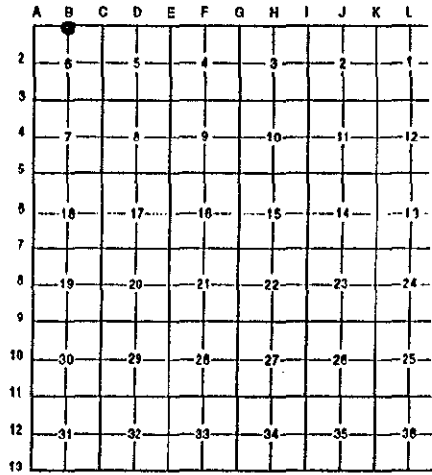

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

B-1	This corner is common with B-13, T4S, R10E	Notes	Post
1817	G.L.O. Fletcher		
1930's	WPA Notes N/A	Section Map and Ties	N/A
1940	Plat Miller	L.67 P.44	Conc. Monument
1940	Plat Miller	L.67 P.45	Conc. Monument
1974	L.C.R.C. Hooth #7966	L. 18906 P. 890	4" Conc. Monument

\$4.00 REMONUMENTATION

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

B-1 The concrete monument and all but one witness has been destroyed by construction work in the area. Using several plat monuments in the above referenced plats, and the one remaining witness (nail w/MDSH tag, N. face power pole, S60°W, 76.22', R&M) from the L.C.R.C. referenced above, I calculated the position of the corner. The distance from the calculated position checks well East and West with WPA distances.

\$7.00 DEED

RECORDED
FOREST E. YOUNGBLOOD, REGISTER OF DEEDS
WAYNE COUNTY, MI
Receipt #43169

Measure West from Reset Corner to A-13, T4S, R10E, 2605.98' (WPA = 2607.08')
Measure East from Reset Corner to C-1 2563.56' (WPA = 2562.96')

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

B-1 Set a 4" x 36" concrete monument with a 1/2" rebar and a 2" diameter aluminum cap stamped "Wayne Co. Remon. #25854" in a gravel drive 6" below the surface.

- *+ on SW Rim Sanitary MH N 81° E 94.14'
- Nail w/MDSH tag North face Power Pole S 60° W 76.22'
- Nail w/WCR tag in S Face Power Pole N 39° W 167.18'
- SE Corner Block Building N 03° E 158.58'

The selected location is accepted by the Contractor and is generally accepted by professional surveyors as the best available evidence of the position of the original corner.

Signed by Randy J. Kolehouse Date 12/16/97
Surveyor's Michigan License No. 25854

