

**SURVEY &
REMONUMENTATION**

APR 25 1995

RC 1604

**LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970**

COMMISSION

For corners in

Wayne (County)	Located in:	City of Flat Rock	Corner Code #
1. Public Land Survey	T <u>4S</u> R <u>10E</u>		<u>E-13</u>
	T _____ R _____		_____
	T _____ R _____		_____
	T _____ R _____		_____
2. Property Controlling In Section	S _____ T _____ R _____		_____
	S _____ T _____ R _____		_____
3. Miscellaneous Property In Sec.	S _____ T _____ R _____		_____
	S _____ T _____ R _____		_____

L127806PA671

Compliance with
ACT 345, P.A. 1990

APPROVED ON: 12-7-94
WAYNE COUNTY REMONUMENTATION
PEER GROUP COMMITTEE

Register of Deeds Stamp & File Number

RC 1604

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, Randy Kolehouse, in a field survey on September 7 19 94, do hereby certify that under requirements of P.A. 74 Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

	A	B	C	D	E	F	G	H	I	J	K	L
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	10	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

E-13	1817	G.L.O. Notes	N/A	Post
	1930's	WPA Notes	N/A	Iron
	1971	L.C.R.C. & Cert Surveys L. 18022 P. 31	Carlson	P.K. Nail
	1971	Cert. Survey L. 18022 P. 38	Carlson	P.K. Nail
	1973	WCRC Notes	N/A	Mon. in Conc. Under 2" A.C. Cap
	1989	Survey SE 1194-6	D.E. Co.	Monument in Hand/Hole

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

E-13 I found concrete monument in a monument box at the center line intersection of Gibraltar Road (concrete) and Cahill Road (gravel) which agrees with the following witnesses:

L.C.R.C. L. 18022 P. 31 WCRC
N 32° E 84.50' to Top of Hydrant (84.40' m) C/L Top Bolt Hyd. NE'ly 84.30' (84.40' m)

D.E. Company
N 35° E 84.23' Hydrant (84.40' m)
N 45° E 64.90' Nail in D.E. Pole (84.85' m)
S 45° E 74.13' Nail in D.E. Pole (74.50' m)


\$ 13.00 MISCELLANEOUS RECORDING
28 DEC 94 9:41 A.M. RECEIPT# 160
RECORDED
FOREST E. YOUNG BLOOD, REGISTER OF DEEDS
WAYNE COUNTY, MI

Measures North to F-11 = 5237.65' (G.L.O. = 2640') (WPA = 5236.76') (CS #119 = 5237.55')
Measures East to F-13 = 2645.04' (G.L.O. = 2640') (WPA = 2646.12') (D.E. Co. = 2645.13')
Measures West to D-13 = 2652.47' (G.L.O. = 2640') (WPA = 2652.62') (CS #119 & 123 = 2652.62')

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

E-13 I set an aluminum cap stamped "Wayne Co. Remon." on existing concrete monument in an existing monument box

P.K. SE Face Util. Pole N 52° E 64.85'
P.K. NE Face Guide Pole S 40° E 74.50'
Conc. Mon. S 08° W 59.94'
E. Most SE Cor. Bldg. #23940 N 26° W 115.32'

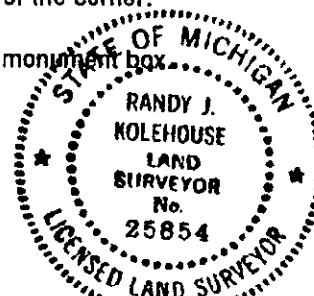

The selected location is accepted by the Contractor and is generally accepted by professional surveyors as the best available evidence of the position of the original corner.

Signed by Randy J. Kolehouse Date 12/14/94
Surveyor's Michigan License No. 25854