

DEC 21 1998

SURVEY & REMONUMENTATION

Libert-30031

FILE DO NOT MAIL

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

MAR 02 1999

SECTION

For corners in

WAYNE (County)	Located in: Brownstown Township	Corner Code #
1. Public Land Survey	T 4S R 10E	G-12
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

Compliance with
ACT 345, P.A. 1990

APPROVED ON: 12-15-98 *DBJ*
WAYNE COUNTY REMONUMENTATION
PEER GROUP COMMITTEE

Register of Deeds Stamp & File Number

Page-781.8

- 4. Lot No. _____, Recorded Plat _____
- 5. Private Claims _____

I, Bruce Antcliff, in a field survey on October 29 19 98, do hereby certify that under requirements of P.A. 74 Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therelore as required in the current manual of survey instructions of the United States Department of the interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

G-12	1. 1817	G.L.O.	Fletcher	Notes	Post
	2. 1930's	WPA Notes	N/A	Section Map and Ties	Iron
	3. 1964	W.C.R.C.	N/A	Witness Records	Iron

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

G-12 No corner found. All previous ties are gone. New industrial plant is on this site. I proportioned the location of this corner using WPA data for the line G-11 to G-13. The angles at G-11 & G-13 match WPA within approx. 20 seconds. The distances match WPA within 0.40 feet. The corner falls in an asphalt parking lot (Lot C) at the Mazda plant.


\$4.00 REMONUMENTATION
RECORDED
FOREST E. YOUNGBLOOD, REGISTER OF DEEDS
WAYNE COUNTY, MI
Receipt #101302
\$7.00 DEED

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

G-12 Set 1/2" rebar and a 2" diameter aluminum cap stamped "Wayne Co. Remon. #25826". Also set A new monument box. (In bituminous parking lot.)

- Set "+" S side concrete base of light pole, N76°E, 26.97'
- Set "+" NW side gate valve box, S70°E, 38.79'
- Set "+" S side concrete base of light pole, N78°W, 161.00'
- Set P.K. w/WCR tag in top of curb, N14°W, 4.85'
- Back of E-W curb, North 4.70'
- E-W fence, North 14.85'

The selected location is accepted by the Contractor and is generally accepted by professional surveyors as the best available evidence of the position of the original corner.

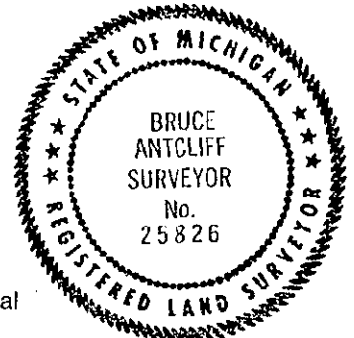

Signed by Bruce Antcliff Date 12-17-98
Surveyor's Michigan License No. 25826

R LCR 7 4R 1PG U DBJ

12/21/1998 09:25AM